



NUMBER: 08-073-14

GROUP: Electrical

DATE: September 05, 2014

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

SUBJECT:

Alternative Method For Adjusting The Headlamps

OVERVIEW:

This bulletin involves an alternative method for adjusting the headlamps.

MODELS:

2014 (LX) 300

DISCUSSION:

If the headlamp cannot be adjusted following the standard adjustment procedure (Phillips #2 screwdriver through cone-shaped opening on back of headlamp) due to stripped adjuster bolt teeth, the headlamp must be adjusted by using a deep wall socket or extension to reach the 12 mm hex manufactured into the adjusting bolt on the backside of the headlamp.

- For right side headlamp: Adjust the headlamp using the hex manufactured into the adjusting bolt on the backside of the headlamp (Fig. 1).
- For left side headlamp: Remove the air box. Adjust the the headlamp using the hex manufactured into the adjusting bolt on the backside of the headlamp (Fig. 1). Reinstall the air box.

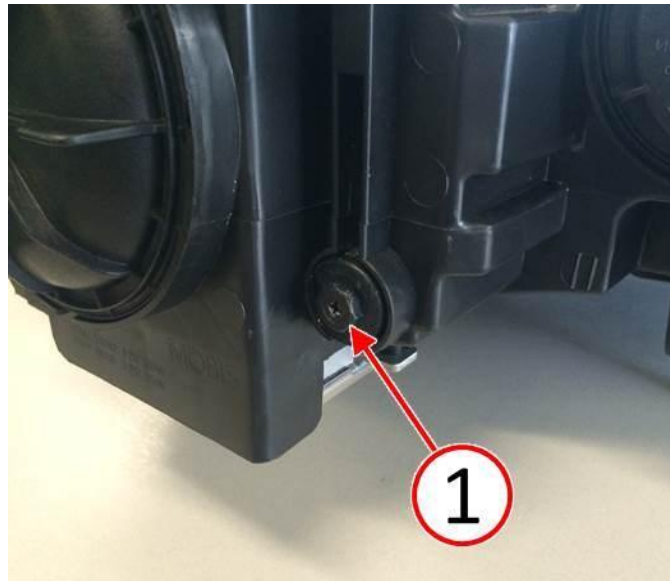


Fig. 1 Headlamp Adjusting Bolt

1 - Adjusting Bolt

POLICY:
Information Only.