TECHNICAL BULLETIN JTB00370NAS1 05 AUG 2014



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

<u> SECTION: 412-01</u>

Condensation on Instrument Panel Center Vent

AFFECTED VEHICLE RANGE:

F-TYPE (X152)

Model Year: 2014 Onwards VIN: K00001 Onwards

MARKETS:

NAS

CONDITION SUMMARY:

Situation: Condensation may be evident on the instrument panel center vent.

Cause: This may be caused by a difference in air/trim temperature, resulting in condensation forming on top of

the instrument panel center vent.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:

T2R16021 Foam pad Quantity: 1

TOOLS:

No Tools Required

WARRANTY:

NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Fit insulation to instrument panel center vent	76.96.28	0.3	42	T2R1446XXX


NOTE: Normal Warranty policies and procedures apply.

SERVICE INSTRUCTION:

1. ANOTE: Removed for access only.

Remove the instrument panel center vent (see TOPIx Workshop Manual, section 412-01).

2. Install the foam pad to the center vent.

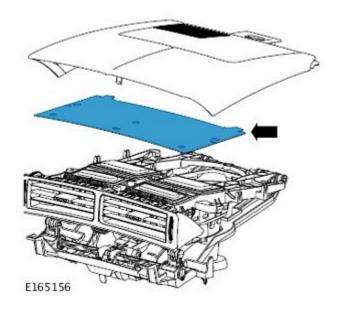

 ${f 3.}$ Install the instrument panel center vent (see TOPIx Workshop Manual, section 412-01). .