

Special Service Message

NOTE: A Special Service Message is a formal communication issued by Jaguar and carries the same importance of a Technical Service Bulletin. An SSM is a quick method of communicating "Need To Know" information to the technical service community. SSM's may be issued in advance of a technical bulletin or may be the only communication on a given topic. All information contained in Jaguar technical communications are intended for use by trained, professional technicians with the knowledge, tools, and equipment required to complete the procedure correctly and safely. It informs the Technicians of conditions that may occur on some vehicles, or provides information that could assist in correct vehicle and diagnostic service.

SSM 71218 - Parkbrake Warning Lamp Illuminated/Parkbrake Fault message displayed - P1571-64

Models : X150 - XK

X250 - XF

X351 - XJ

Engineer Shenton Andy

Name :

Last 21-01-2014 10:37:59

Modified :

Category : Chassis

Symptom : 301000 Service Brake System

Content : **Issue:** Customer reports a Parkbrake Warning Lamp Illuminated and / or Parkbrake fault message displayed in the IPK (Instrument Pack), following investigation with SDD the following DTC P1571-64 (Brake Switch - Signal plausibility) is stored.

Cause: A Communications issue between the Powertrain Control Module and the Parkbrake Module.

Action: If U0100-00 has been logged along with P1571-64 and there are no other P-codes relating to Brake Light Switch logged in the Powertrain Control Module, then there is unlikely to be an issue with the Brake Light Switch. JLR are currently developing a fix for this issue. Until the fix is developed and released the correct action for this issue is only to clear the DTC's. Adjusting or replacing the Brake Light Switch will not resolve this issue.