

Technical Service Bulletin



00 PDI inspection - IQS supplement

00 13 57 2035669/2 November 11, 2013. Supersedes Technical Service Bulletin Group 00 number 13-56 dated November 1, 2013 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A7, Q5, Q7	2014	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Service</i> (Added Q5 wind noise information)
1	11/1/2013	Initial publication

There are special service instructions to be performed on all Model Year 2014 A6, A7, Q5, and Q7 vehicles *before* the vehicles are delivered to customers.

Technical Background

When performing PDI inspections on vehicles delivered from November 2013 - February 2014, please prepare the vehicles for delivery with a special focus on the areas listed in this bulletin. These checks can be performed during the normal PDI inspection process.

Contact the Technical Assistance Center (TAC) with any questions about the information in this bulletin.

Production Solution

Not applicable.

Service

The Service steps below are sorted by model. Refer to the appropriate section for the model that is being inspected.

For 2014 A6 and A7:

✓ Check Brakes for Pulsation/Vibration (3.0T engines only):

- If vibration or pulsation is felt while braking (in brake pedal or in entire vehicle) at speeds higher than 20 mph, put the vehicle on a lift and inspect the brake discs for pad marks (Figure 1).
- Replace only those brake discs that have pad marks (Figure 1). Use the following part numbers:
 - Front brake disc: **4G0615301A**
 - Rear brake disc: **4H0615601H**



Figure 1. Brake pad marks on brake disc.

For 2014 Q5:

✓ Check for Rattle Noise in Driver Side Door or Dash:

- During test drive, drive over a bumpy road. If a rattling or buzzing noise is heard from the dash area, refer to instructions in TSB 2035626: *Rattle noise from driver side door or dash area*.

✓ Check for Brake Squeal from Front Brakes (Non-Hybrid Vehicles only):

- If a squealing sound is heard when brakes are applied lightly when the vehicle is driven at a low speed, submit a PSS ticket under the topic *PSS 46 Brake noise (non-hybrid vehicles)*.

✓ **Check for Wind Noise:**

- If wind noise is heard from the exterior rear view mirrors (typically heard at highway speeds), refer to TSB 2035673: *66 Wind noise from exterior rear view mirror.*

For 2014 Q7:

✓ **Check for EVAP Leak DTC in Engine Control Module (ECM) (3.0T engines only):**

- Use ODIS to check the DTC memory of the ECM, J623 (address word 01) for the following DTCs:
 - **DTC P0456** (EVAP System Leak Detected (very small leak))
 - **DTC P0442** (EVAP System Leak Detected (small leak))
- If either DTC is present, replace the Leak Diagnostic Pump (LDP).
- Use the following part number:
 - LDP: **7L8906271A**

✓ **Check A Pillar Trim:**

- If the A pillar trim on either side of the vehicle is loose or ill-fitting as shown at right (Figure 5), replace the trim.



Figure 5. Loose A pillar trim.

- When installing the new trim make certain that the assembly support strap is not trapped or pinched between the adapter and the A pillar structure (Figure 6).

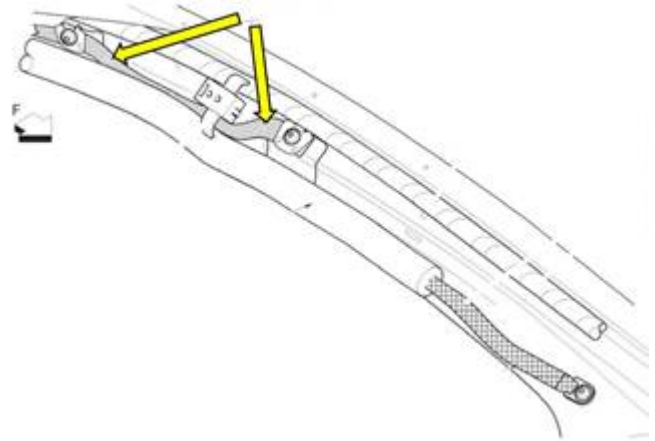


Figure 6. Location of the assembly support strap along A pillar trim bracket.

Warranty

Use applicable labor operations as per Elsa for each repair performed.

Additional Information

All parts and service references provided in this TSB (2035669) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.