



NUMBER: 08-100-14

GROUP: Electrical

DATE: December 02, 2014

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

SUBJECT:

Loss Of Power Heated Mirror Function - Recall P61 Interim Repair

OVERVIEW:

This bulletin involves removing the M35 fuse.

MODELS:

2011 - 2013 (JK) Jeep Wrangler

NOTE: This bulletin applies to vehicles built on or after February 16, 2010 (MDH 0216XX) and on or before July 19, 2013 (MDH 0719XX) equipped with Power Heated Side Mirrors (Sales Code GTB).

DISCUSSION:

The power side view mirrors may experience a loss of right and/or left heated power mirror function. Water may travel along the heated power mirror wiring harness and into the heated power mirror electrical connector(s). This can cause corrosion inside the heated mirror connector(s) and the formation of a resistive bridge between the power and ground electrical terminals. A resistive bridge between the power and ground electrical terminals in the heated power mirror connector(s) could cause an electrical fire without warning.

Chrysler intends to repair the vehicle free of charge (parts and labor). However, the parts required to provide a permanent remedy for this condition are currently not available. Chrysler is making every effort to obtain these parts as quickly as possible. Chrysler will contact customers by mail, with follow-up recall notice, when the remedy parts are available.

In the meantime, if the customer is uncomfortable with the current situation, remove the 10 amp red M35 heated mirrors fuse from the totally integrated power module (TIPM)([Fig. 1](#)). Refer to the fuse location printed on the back side of the TIPM cover.

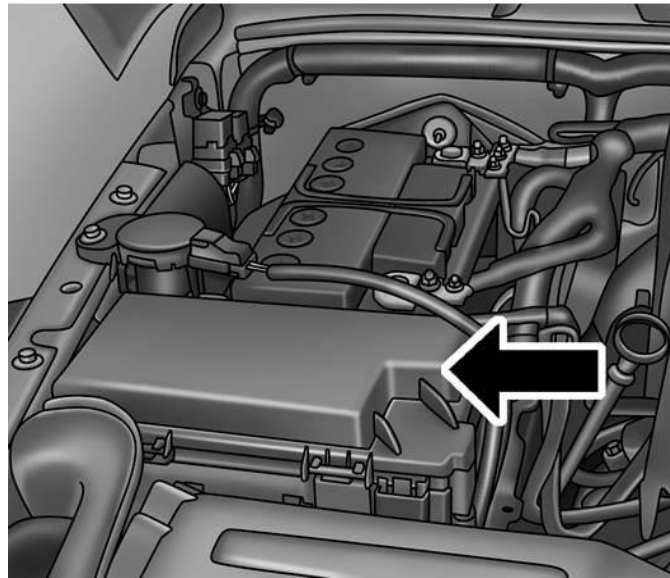


Fig. 1 Totally Integrated Power Module

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

| Labor Operation No: | Description | Skill Category | Amount |
|---------------------|--|---------------------------------|----------|
| 08-95-05-90 | Fuse - Totally Integrated Power Module - Remove M35 Power Heated Mirror Fuse (1 - Semi-Skilled) | 6 - Electrical and Body Systems | 0.2 Hrs. |

FAILURE CODE:

| | |
|----|----------------|
| ZZ | Service Action |
|----|----------------|