

ATTENTION:
 GENERAL MANAGER
 PARTS MANAGER
 CLAIMS PERSONNEL
 SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.

© 2014 Subaru of America, Inc. All rights reserved.



QUALITY DRIVEN® SERVICE

SERVICE BULLETIN

APPLICABILITY: 2014MY XV Crosstrek Hybrid (HEV)

NUMBER: 07-87-14

SUBJECT: Design Change of Rear Combination Lamps to Prevent Fogging and Condensation

DATE: 10/15/14

INTRODUCTION


This bulletin provides information regarding design changes to the rear combination lamp assembly to prevent fogging and accumulation of condensation. These changes involve:

- An Anti-Fog coating is now applied during production to the inner surface of the outer lens.



Anti-Fog coating applied on the inner surface of the outer lens.

- Additional ventilation added to the bottom portion of the housing.

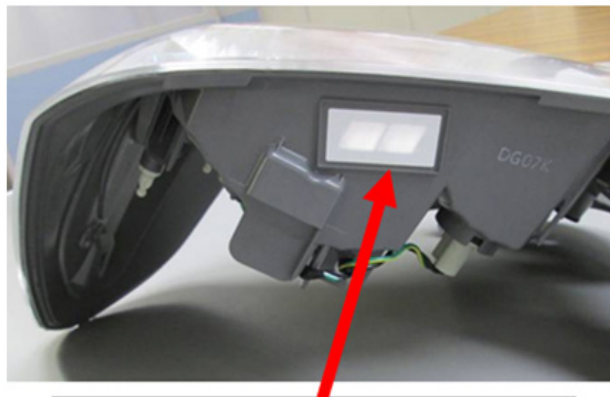


Additional ventilation added.

Continued...

<p>CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.</p> <p>Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.</p>	<p>SUBARU OF AMERICA, INC. IS ISO 14001 COMPLIANT</p> <p>ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.</p>
--	--

- Revised shape and locations for the 4 existing ventilation holes.

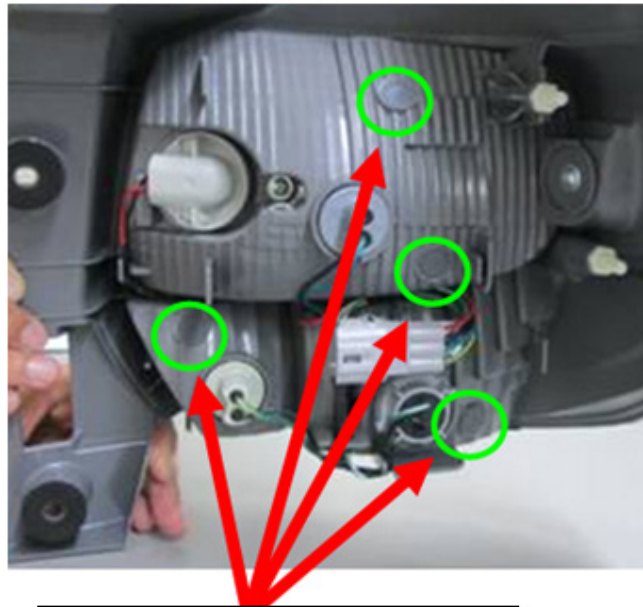

Shape and locations of 4 ventilation holes changed.

COUNTERMEASURE IN PRODUCTION

The revised rear combination lamps were incorporated into production during July, 2014 starting with VIN E*330494.

PART INFORMATION

PART NUMBER	DESCRIPTION
84912FJ320	LENS & BODY COMPL
84912FJ330	

SERVICE PROCEDURE / INFORMATION

When replacing the combination lamp assembly, follow the procedure outlined in the applicable Service Manual. Only the affected side combination lamp should be replaced unless the condition has been confirmed on both.

WARRANTY / CLAIM INFORMATION

For vehicles within the Basic New Car Limited Warranty period, this repair may be claimed using the following information:

LABOR DESCRIPTION	LABOR OPERATION #	FAIL CODE	LABOR TIME
ONE REAR COMBINATION LAMP R&R	B916-201	XCB-48	0.2
BOTH REAR COMBINATION LAMPs R&R	B916-204		0.3

REMINDER: SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time. **Always refer to STIS for the latest service information before performing any repairs.**