

Tech Tips

TT 44-14-02

Date: July 18, 2014

2012-2015 Passat, Jetta (16), Beetle/Beetle Convertible, Golf/GTI, Tiguan– ABS/TPMS light is on due to wheel speed sensor fault as a result of the Front Wheel Bearing / Wheel Speed Sensor swapping



Encoder Ring Destroyed

This can be due to the Encoder Ring being ground down on the wheel bearing hub unit, resulting in a damaged part.

Cause: Damage from swapping the speed sensors left to right (or vice versa) during diagnosis.
(Complete width of encoder damaged)



Speed Sensor Interference



Tip:

Discontinue the practice of swapping sensors from side to side during workshop diagnosis.