

TECHNICAL BULLETIN
LTB00665NAS1
06 JUN 2014



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-05

Sun Visor Vanity Mirror - Lower-Level Service Repair

AFFECTED VEHICLE RANGE:

LR3 (LA)

Model Year: 2005-2009
VIN: 5A000360-9A513325

LR4 (LA)

Model Year: 2010 Onwards
VIN: AA510742 Onwards

Range Rover Sport (LS)

Model Year: 2006-2013
VIN: 6A900129-DA814822

MARKETS:

NAS

CONDITION SUMMARY:

Situation: A lower-level service repair part is now available in the event of a front sun visor vanity mirror issue.

Cause: A lower-level service repair part to be used in the event a front sun visor vanity mirror requires replacement.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:

LR063681	Sunvisor (Ivory) - Range Rover Sport (L320)	Quantity: 1
LR063682	Sunvisor (Ebony) - Range Rover Sport (L320)	Quantity: 1
LR063683	Sunvisor (with illumination) - LR3 / LR4 (L319)	Quantity: 1
LR063684	Sunvisor (with illumination and ECE94 Label) - LR3 / LR4 (L319)	Quantity: 1
LR063685	Sunvisor (with no illumination) - LR3 / LR4 (L319)	Quantity: 1
LR063686	Sunvisor (with no illumination and ECE94 Label) - LR3 / LR4 (L319)	Quantity: 1

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part**

number with a quantity of zero.


DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Sun visor vanity mirror - Lower-level repair	76.11.37	0.1	42	LR030690



NOTE: Normal Warranty policies and procedures apply.

SERVICE INSTRUCTION:

- Using a suitable trim tool, release the four (4) clips securing the vanity mirror from the sun visor.


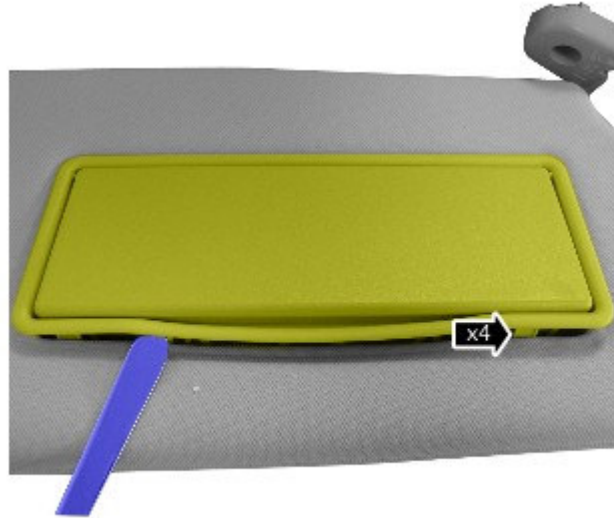


E164185

-  **NOTE: Make sure to cut the wires as close to the vanity mirror as possible.**

Cut the two (2) wires to the vanity mirror.


- Discard the vanity mirror.

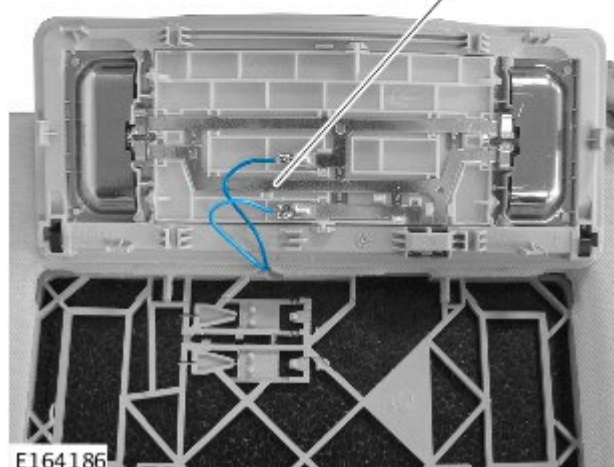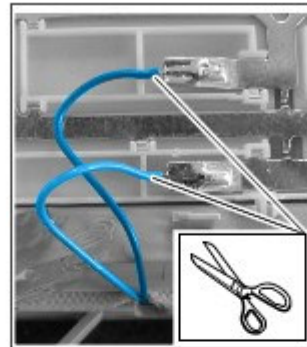


E164186

3. Using a suitable crimp tool, following the instructions for wiring harness repair (see TOPIX Workshop Manual, section 418-02).

- Strip the insulation off the two (2) vehicle harness wires and install the two (2) electrical connectors to the vehicle harness.

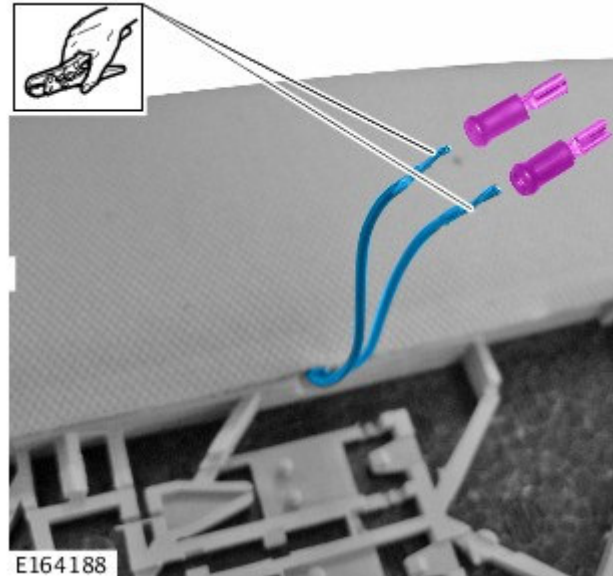


4. Install the two (2) connectors to the new vanity mirror.

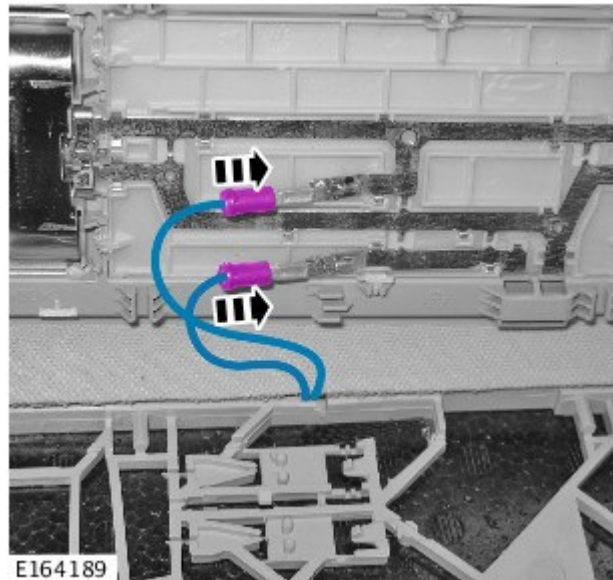

5.  **NOTE: Do not use excessive force to install the new sun visor vanity mirror.**

Install new sun visor vanity mirror, pressing firmly against the areas indicated until an audible 'click' is heard.

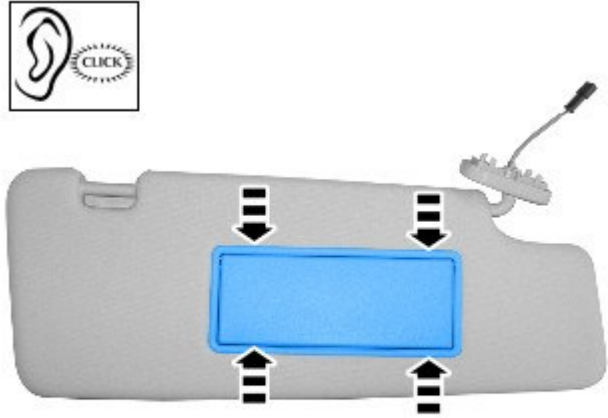

E164190