

A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the [Elsa Newsletter](#) section in the Technician References menu.

VW Elsa Newsletter



Das Auto.

Edition 81: April 14, 2014

Content

- [Technical Bulletins](#)
- [Pending Service Solutions](#)
- [Tech Tips](#)
- [Campaigns](#)
- [Updates](#)
- [Suggestions](#)



Technical Bulletins

97 14 01 - 2036976 Under Hood Fuse Panel (SA/SB assembly) with part number 000 937 125 Supplied Without Power Distribution Bar (SA panel)

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Tiguan, Jetta	2009	All	All	All	All

The supplied under hood fuse panel (SA/SB assembly) with part number 000 937 125 comes without the power distribution bar (SA panel). When replacing an under hood fuse panel, the technician must remove the power distribution bar from the original under hood fuse panel and install it on the new assembly.

Production Solution: Not applicable.

00 14 04 - 2010380 Supersedes Technical Bulletin V001202 dated March 24, 2012 to include additional model year applicability and add VWoA parts equivalencies.

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
All	1995–2014	All	All	All	All

Squeaks, Rattles, Noise, Repair Materials
Production Solution: Various concerns of squeaks, rattles, noise, trim fit conditions etc.

Pending Service Solutions

No new Pending Service Solutions this week.

[Back to top](#)

Tech Tips

48-10-04 Replacement Steering Harness

Model(s)	Year	Eng.Code	Trans.Code
Jetta	2005–2009	All	All
GTI	2006–2009	All	All
EOS, Rabbit	2007–2009	All	All
Tiguan	2009	All	All
Passat with 1K0 Part Number J500	2009	All	All

If the steering rack is replaced on the above models for any reason, it is necessary to replace the steering harness as well. The new harness may be equipped with an extra connector. If all connections are made correctly, then it is necessary to remove that connector and tape the exposed wires back into the harness. Be sure to tape tightly in order to provide a water-tight repair.

91-14-03 Coding Information for Replacing "AC" Suffix Radios with "AF" Suffix Replacement Unit

Model(s)	Year	Eng.Code	Trans.Code
Vehicles equipped with Premium (RCD 510) Radios	2010–2011	All	All

When replacing the radio on a 2010–2011 vehicle equipped with a Premium 8 (RCD 510) radio with part number ending in the suffix "AC" (1K0 035 180 AC), if the replacement part has a suffix "AF", make sure that online coding is performed. **DO NOT PERFORM ANY SOFTWARE UPDATE OF THE "AF" RADIO USING AN SD CARD OR ANY OTHER MEANS.** No software updates are available for "AF" suffix radios. Any attempt to update the software using an SD card or other means can result in permanent damage to the radio.

**92-12-01 Rain Sensing Windshield Wipers
April 11, 2014: Update to Information.**

Model(s)	Year	Eng.Code	Trans.Code
Passat	2012–2014	All	All

Be aware that 2012–2014 Passat vehicles are not equipped with the rain sensing windshield wiper function. The G397 Rain/light recognition sensor is present on all 2012–2014 Passat vehicles but this sensor is used only for auto headlamp function.
Be aware that 2012–2014 Passat vehicles are not equipped with the rain sensing windshield wiper function. The G397 Rain/light recognition sensor is present on all 2012–2014 Passat vehicles but this sensor is used only for auto headlamp function.

[Back to top](#)

Campaigns

CANADA ONLY: 19J9 - Disable Engine Block Heater

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Golf, Passat, Jetta, Golf Wagon	2013–2014	All	All	Check Elsa on the day the campaign work will be performed to verify vehicle eligibility	Check Elsa on the day the campaign work will be performed to verify vehicle eligibility

The factory - installed engine block heater could overheat during use, resulting in a possible fire

[Back to top](#)

Updates

No new updates this week.

Suggestions

Please send comments or suggestions to: vwoa.workshopinformation@vw.com

[Back to top](#)

© 2014 Volkswagen of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.