A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the <u>Elsa</u> <u>Newsletter</u> section in the Technician References menu.



Audi Elsa Newsletter

Edition 80: April 7, 2014

Content

- Quick Spec Guides Now published on ServiceNet
- <u>Technical Bulleti</u>ns
- Pending Service
 Solutions
- <u>Campaigns</u>
- **Updates**
- Suggestions



Quick Spec Guides Now published on ServiceNet

All 2014 MY Quick spec guides are now published to ServiceNet. To access, log into SeviceNet and go to "Quick Ref Spec Books", under the Technician References menu item. Or click here.

Back to top

Technical Bulletins

90 Head-up display (HUD) dims or flickers (2036132/2)				
Model(s)	Year Vehicle Specific Equipment			
A6, A7	2012-2014	Technology Package (Ordered as WPD), PR-KS1		

Condition: Customer may report that the head-up display (HUD) flickers or dims quickly.

Production Solution: Optimized software. The new software prevents fast changes in the brightness of the head-up display. It does not affect the screen brightness level relative to ambient light.

94 Headlight range control warning displayed in instrument cluster (2024877/6)

Model(s)	Year	Vehicle Specific Equipment	
A8	2008-2010	Adaptive/Cornering light	
A6	2008-2011	Adaptive/Cornering light	
Q7	2008-2015	Adaptive/Cornering light	
TT RS	2012-2013	Adaptive/Cornering light	

Condition:

- The warning light for dynamic headlight range control is displayed in the instrument cluster.
- The following DTC is stored in the headlamp range control module, J431 (address word 55):
 - DTC 00003 14 (Control module faulty)
 - o Both headlights function normally.
 - o The vehicle is equipped with adaptive (cornering) lighting.

Production Solution: New software in the J431 control module addresses the condition.

46 Brake noise analysis and handling (2034181/7)					
Model(s)	Year	Vehicle Specific Equipment			
R8	2014	Without ceramic brakes			
A6, Allroad	2013-2014	2.0T			
A6	2012–2014	3.0T & 4.0T			
A7	2012-2014	Not applicable			
A5, S5	2013-2014	Not applicable			
A5/S5 Cabriolet, A4, S4, TT, TTS	2013-2014	Not applicable			
Q5 Hybrid	2013-2014	Hybrid			
RS 5, RS 5 Cabriolet	2013-2014	Without ceramic brakes			
A8	2013-2014	4.0T			

Condition: The customer may report hearing brake noise from front or rear brakes. The customer may describe these noises as a squeal, squeak, grinding, groaning, thumping, or creaking. **Production Solution:** Not applicable.

Pending Service Solutions

PSS 46 A8 3.0T Brake noise (PR-1LL) (2036855/1)				
Model(s) Year		Vehicle Specific Equipment		
A8	2013-2014	3.0T with PR-1LL		

Condition: Customer reports hearing brake squeal when the vehicle comes to a stop at slow speeds. In some cases, the noise may be intermittent and difficult to reproduce. **Production Solution:** Not applicable.

Back to top

Campaigns

24AM - 2008–2012 MY Audi S5 with 4.2L Engine & Manual Transmission ECM Software					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
S5	2008- 2012	4.2L Engine	Manual	Check Elsa on the day the campaign work will be performed to verify vehicle eligibility for the repair	Check Elsa on the day the campaign work will be performed to verify vehicle eligibility for the repair

Some vehicles may experience random cylinder misfires during cold start or warm up which could cause the Malfunction Indicator Light (MIL) to come on. If the MIL is on because of this issue, a vehicle will not pass an IM (emissions) inspection.

Back to top

Updates

87D9 UPDATE - AC Pressure/Temperature Sensor (NVLW)					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
R8 Coupe, R8 Spyder, A6, S6, A7, S7, A8, S8, A5 Cab, S5, Cab, RS5 Cab, A4 S4, Allroad, Q5, Q5 hybrid, A5, S5, RS5	2013- 2014	All	All	See Campaign/Action screen in Elsa	See Campaign/Action screen in Elsa

This Update has been proactively released to prevent the following condition from occurring in the vehicle: On Audi vehicles manufactured within a specific period, the refrigerant pressure sensor for the air conditioner may fail after a period of time. As a result, the air conditioner compressor is switched off. This Update is in effect until removed.

Vehicle must meet all of the following criteria:

- Procedure is valid only for vehicles that show the 87D9 code in the Elsa Campaign/Action Information screen on the day of repair.
 - Vehicle must be within the New Vehicle Limited Warranty.
 - Procedure must be performed within the allotted time frame stated in this Technical Service Bulletin.
 - Procedure must be performed on applicable vehicles in dealer inventory prior to sale.

Suggestions

Please send comments or suggestions to: aoa.workshopinformation@audi.com

Back to top

© 2014 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.