

**SB-10041404-9666**

**Countries:** COLOMBIA, UNITED STATES, PUERTO RICO  
**Availability:** ISIS  
**Major System:** ELECTRICAL SYSTEM  
**Current Language:** English  
**Other Languages:** [Français](#), [Español](#),  
**Viewed:** 452

**Document ID:** IK0800298  
**Revision:** 2  
**Created:** 8/17/2011  
**Last Modified:** 7/3/2014  
**Author:** Chris Moody

[Less Info](#)

Hide Details

Coding Information

|                      |                               |  |                             |                  |                             |                           |                              |
|----------------------|-------------------------------|--|-----------------------------|------------------|-----------------------------|---------------------------|------------------------------|
| <b>Copy Link</b><br> | <b>Copy Relative Link</b><br> | <b>Bookmark</b><br><br><a href="#">View My Bookmarks</a> | <b>Add to Favorites</b><br> | <b>Print</b><br> | <b>Provide Feedback</b><br> | <b>Helpful</b><br><br>194 | <b>Not Helpful</b><br><br>63 |
|----------------------|-------------------------------|--|-----------------------------|------------------|-----------------------------|---------------------------|------------------------------|

**Title:** Headlight Harness Incorrect Install

**Applies To:** Model TranStar 8600

**CHANGE LOG**

**NOTE: DO NOT delete this Change Log. If this iKNOW Article is being revised, please type in the text box below what has changed in the article. The change log is meant for Dealers to be able to see what has updated/changed in the article.**

**Dealers: Please refer to the change log text box below for recent changes to this article:**

7/3/2014 - Author updated for feedback purposes.

**DESCRIPTION**

Harness of headlight may be installed in the wrong location under the hood on TranStar 8600 models. This could cause interference between the heat exchanger and torsion bar when the of the hood is closed, which can lead to premature failure of either headlight interconnect.

**SYMPTOMS**

- Intermittent or nonoperational headlight bulb.
- Body Controller Fault Codes: 2653 RH Low Beam, 2655 LH Low Beam, 4011 LH High Beam, or 4012 RH High Beam

**TROUBLESHOOTING**

- 1 . Locate the connector as shown on the right side of the hood.
2. Inspect for the proper location.





**Figure 1: Incorrectly Installed**




**Figure 2: Correctly Installed**

**RESOLUTION**

1. Inspect the wiring and connector for damage.
2. If damage is found - Repair the damaged wires or connector.
3. Move the connector to the correct location.





**Figure 3: Move connector**

- 1. Incorrect position
- 2. Correct position

 Hide Details

Feedback Information

Viewed: 451  
Helpful: 194  
Not Helpful: 63

No Feedback Found