HONDA

sB-10053270-8304 Service Bulletin



Applies To: 2013 Accord Equipped with HFL (HFT) Control Units – ALL 2013 Crosstour Equipped with HFL (HFT) Control Units – ALL August 23, 2013

Updating Programmable HFL (HFT) Control Units - Accord and Crosstour

BACKGROUND

The procedures in this service bulletin are used and referenced in other service bulletins.

This bulletin describes the procedure to update the software in programmable HandsFreeLink (HFL) control units.

This bulletin consists of three different featuredependent procedures:

- Vehicles without Navigation and without Touchscreen, page 2.
- Vehicles with Touchscreen Audio, page 6.
- Vehicles with Touchscreen Navigation, page 10.

Some models with touchscreen navigation may need Audio Navigation Unit Update, page 14.

This service bulletin also describes these subjects:

- · Required tools and equipment
- · Updating tips and precautions
- Who to contact for questions or problems when using Honda-supplied updating equipment, including software and tools.

NOTE: Whenever you install a new HFL control unit, check that it has the latest software, and update it if needed.

WARRANTY CLAIM INFORMATION

Refer to the specific service bulletin for the symptom you are repairing.

QUESTIONS ABOUT THE UPDATING EQUIPMENT OR THE INTERACTIVE NETWORK

For cellular phone compatibility listings or required settings, call JCI Technical Support at **888-528-7876**.

For HFL PC software installation or Bluetooth pairing issues, call the iN Support Center at **800-245-4343**.

For HFL module reprogramming (vehicle side) and general troubleshooting, call Tech Line at **800-824-6632**.

REQUIRED TOOLS AND EQUIPMENT

- A laptop PC, loaded with the newest version of the HDS software, and equipped with the minimum requirements:
 - Any version of Windows listed below:
 - Windows XP (32-bit), at least 512 MB RAM, and Service Pack 2
 - Windows Vista/7 (32-bit), at least 1 GB RAM
 - Windows 7, (64-bit), at least 2 GB RAM
 - 1 gigahertz (GHz) or faster 32-bit (x86) or 64-bit (x64) processor
 - At least 16 GB of available hard disk space (32-bit) or at least 20 GB hard disk space (64-bit; Windows 7 only)
 - Windows Vista Only: Support for DirectX 9 graphics with WDDM and at least 128 MB of graphics memory (32 MB for Home Basic)
 - Windows 7 Only: DirectX 9 Graphics device with WDDM 1.0 or higher driver
 - The Microsoft.NET Framework software application: Version 2.0 or later

NOTE: This is available to download for free; go to *microsoft.com* or ask your system administrator for assistance.

- The latest version of the HDS software installed on this computer. See the specific service bulletin that you are applying for additional information.
- A recognized Bluetooth radio device installed on this computer. If one is required, order P/N: CDWF8T016 from the Tool and Equipment Program (on iN, click on: Service > Quick Links > Tool and Equipment Program), or choose a commercially available device from the list below.

Brand	Model #	OS*	32-bit	64-bit
Targus ¹	ACB10US1	ALL	Х	Х
Cirago ²	BTA-3210	ALL	Х	Х
IO Gear ¹	GBU421	ALL	Х	Х
Rocketfish ¹	RF-MRBTAD	ALL	Х	Х

* Windows XP, Windows Vista, or Windows 7 Operating System

¹ Use Widcomm (Broadcom) Bluetooth drivers.

² Use Toshiba Bluetooth drivers.

© 2013 American Honda Motor Co., Inc. – All Rights Reserved

Skill Level

R

REPAIR

ATB 50097 (1308)

SUPPLEMENTAL SOFTWARE INFORMATION

USB Flash Drive with Audio Navigation Unit Software: T/N 07AAZ-T2JA100

NOTE: Use T/N 07AAZ-T2JA100 to update the audionavigation control unit only when the PIN is not visible. Refer to HFL CONTROL UNIT UPDATE, Vehicles with Navigation, step 8, on page 11.

HFL CONTROL UNIT UPDATE PROCEDURE

Vehicles without Navigation and without Touchscreen

NOTE: Failure to follow the procedures and precautions in this bulletin may damage the HFL control unit.

- 1. Connect a battery charger to the vehicle and leave it connected during the entire procedure to maintain a steady voltage.
- 2. Turn the ignition switch to ON (II).
- 3. Press and hold the audio preset No. 1 button, then press and hold the audio preset No. 6 button. Finally, press and hold the audio power button. Release the buttons once the audio unit enters the **Diag** screen.



 Press and hold the PHONE button for at least 5 seconds to enter the HFL diagnostic mode.
B1775 OK appears on the screen.



5. Press the audio preset No. 2 button; the current software version appears on the screen.



 On the HDS laptop, double-click the HFL(HFT) Control Unit Update icon to launch the HFL (HFT) Control Unit Update tool window (HFL update tool).

NOTE: The HDS laptop must be connected to an AC outlet during the reflash process and must be within a distance of 21 feet to the vehicle. Do not allow the HDS laptop to go into sleep or hibernate mode during the reflash process. If this occurs, the bluetooth connectivity between the HDS laptop and the vehicle's HFL system will be dropped, and the reflash process will be interrupted. It will then be necessary to restart the reflash procedure. See your laptop manufacturer's instructions or your system administrator for assistance to change these settings.



7. Press the selector knob on the audio unit to begin the update. The current software version and a four-digit PIN code (also known as a PASS code) will flash on the screen. Write it down on a piece of paper and leave it in the vehicle.

NOTE: This PIN code is required to complete the HFL update. Write this PIN down.



8. In the HFL update tool, click on the Bluetooth icon in the upper left corner of the screen to pair with the vehicle's HFL.



NOTE: If an active Bluetooth adapter is not found on the HDS laptop, this error message will appear. Review the REQUIRED TOOLS AND EQUIPMENT section of this bulletin for a recognized Bluetooth device. Contact your IT support for additional help.




9. In the HFL update tool, the **Pair with HFL** window pops up. Wait a few seconds for the display to show **All Detected Bluetooth Devices**. If no devices are found after about 30 seconds, click **Refresh**.

Callender	No 1912 Demons Found	1
0740	Distic Term Aldren	
· Ladas Puchas Liptem Parket		
	Pit Detail	

10. In the HFL update tool, once the Bluetooth device has been detected, enter the four-digit PIN code from the vehicle's display screen into the lower lefthand corner of the pop-up window. Click **Pair** to begin the pairing process.




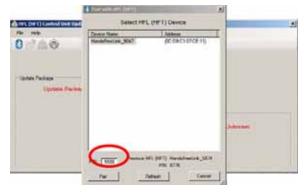


11. Wait for the HFL update tool to complete the Bluetooth pairing process.



12. In the HFL update tool, the **Open Update Package** window pops up when the Bluetooth pairing process is complete. The HFL update tool automatically determines which version of the HFL software is present. The compatible updates will be displayed on the HFL update tool.

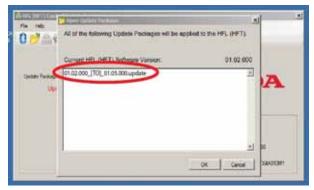

13. Click **OK** to begin the HFL control unit reflash process.

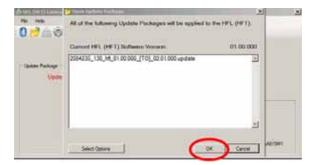

NOTE: If the HFL software is current and no update is required, the following notification appears on the HFL update tool: **The vehicle does not need an update at this time**.

	The setticity share roll record ar optimic at this	>	, XI
0 2 60.1	Current HPL (HP1) Suffeene Version	02.01.000	
Lipites Package		2	
		1	20 ZAALTABET
·	Select Denvis	Cent	2000/14081

14. The HFL reflash process begins. Allow several minutes for the programming to complete. The blue bars indicate the programming status and progression.

NOTE: Do not turn the engine OFF while the HDS laptop is transferring files to the HFL control unit. If the Bluetooth connectivity between the HDS laptop and the HFL control unit is lost, the ignition must remain ON. Reboot the HDS laptop and restart the HFL update tool. Make sure you use the four-digit PIN you wrote down.

240		
	HEL (HET) C	lonnected
bride Fackage		
Applying Up	dates	
jobele Venico-	12,01,000	
contracting Files	ie 10	HE (47)
		HandsFreeLink_9047
ophrig File:	up.10	HFL HFT) Software Version: 0100.000
		Honda Part # 2877073AA315M1

15. In the HDS laptop, a pop-up window alerts you when the reflash process is finalizing, and then another pop-up informs you that the reflash process has completed.

Service () (Service Controlled) File (Nob	
0 - 2 👘 Ф	onnected
Update Package	
The HFL (HFT) is finalizing the Vander Venuer wat	
Devriceding Files	9047
Applying Flat. up 17	HFL HFT) Schware Verson: \$1.00.000
Acolong Re. up 17	HFLEFF)Schware Verson (FLE1200) Handa Part # 357707244315M1

16. In the HFL update tool, click **OK** when the pop-up window indicates the reflash process is complete. NOTE: Failure to wait for the HDS laptop message **Lindate Complete** to display before turning the

Update Complete to display before turning the ignition OFF will interrupt the HFL programming and will damage the HFL control unit.

x
rnected
nd perfere the sufficience version is OK (147
+#L 9477) Software Western: 01.00.000 Hends Part #: 287787244215941

17. The HDS laptop will indicate the update is complete, and automatically disconnects the Bluetooth connection from the HFL control unit. Close the HFL update tool by clicking on the **X** in the upper right-hand corner.



18. The vehicle's audio screen will indicate the HFL tool update has been completed.



- 19. Do the following to confirm that the software in the HFL control unit has been updated:
 - Turn the ignition OFF.
 - Wait 10 seconds, then repeat steps 2 through 5 to place the audio system in self-diag mode and check the software version is updated.

HFL CONTROL UNIT UPDATE PROCEDURE

Vehicles with Touchscreen Audio

NOTE: Failure to follow the procedures and precautions in this bulletin may damage the HFL control unit.

- 1. Connect a jumper battery to the vehicle and leave it connected during the entire procedure to maintain a steady voltage.
- 2. Turn the ignition switch to ON (II).
- 3. Wait for the audio unit to boot up. When the disclaimer screen appears, press and hold the VOL, the DISP, and the BACK buttons for at least 5 seconds until the **Select Diagnosis Items** screen appears.



4. Select Self Diagnosis Mode.



5. The **System Links** screen appears and does an automatic diagnostic check. Wait a few moments while the process completes. Once completed and the message **Press any icon if you want to see details** appears, select **HFL**.



 On the HDS laptop, double-click the HFL (HFT) Control Unit Update icon to launch the Honda HFL (HFT) Control Unit Update tool window (HFL update tool).

NOTE: The HDS laptop must be connected to an AC outlet during the reflash process and must be within a distance of 21 feet to the vehicle. Do not allow the HDS laptop to go into sleep or hibernate mode during the reflash process. If this occurs, the Bluetooth connectivity between the HDS laptop and the vehicle's HFL system will be dropped, and the reflash process will be interrupted. It will then be necessary to restart the reflash procedure. See your laptop manufacturer's instructions or your system administrator for assistance to change these settings.

A lost terminal have backet	
0.740	(T) Not Connected
- Gelan Palage Openheir Heckage Ned Schederd	HELETE

7. On the **HFL** screen, select **Reflash**. The HFL system enters its reflash readiness mode.

NOTE: If the **HFL** is **NG** the **Reflash** button will be grayed out, and you will not be able to complete the HFL Control Unit Update Procedure. Troubleshoot for and repair any audio DTCs before continuing.

HFL	Return
HFL	OK
GA-NET	OX
USB	OK
Physical Address	8E
S/W Version	02.01.000
Part Number	39770T2AA715M1
	Reflash

8. The HFL software update screen displays a fourdigit PIN code.

NOTE: Write this PIN down because you will need it to complete the HFL update.



9. In the HFL update tool, click on the Bluetooth icon in the upper left corner of the screen to pair with the vehicle's HFL.

Philippine Street Contracts	
0-7@@ with	PT) Net Converted
- Salate Package - Signatur Package Not Robertsol	- IPL (PT) Universe


NOTE: If an active Bluetooth adapter is not found on the HDS laptop, this error message will appear. Review the REQUIRED TOOLS AND EQUIPMENT section of this service bulletin for a recognized Bluetooth device. Contact you IT support for additional help.



 In the HFL update tool, Pair with HFL window pops up. Wait a few seconds for the display to show AII Detected Bluetooth Devices. If no devices are found after about 30 seconds, click Refresh.




11. In the HFL update tool, once the Bluetooth device has been detected, enter the four-digit PIN code from the vehicle's display screen into the lower left hand corner of the pop-up window. Click **Pair** to begin the pairing process.

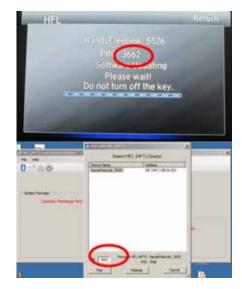


12. Wait for the HFL update tool to complete the Bluetooth pairing process.

0 2 4 4			
0 Craw	HFL (HFT) Co	resolut	
Update Package	65		
Color of the	Contraring Research Law		
F			
100 C		Hestified at	1004
		HFL (HT) Suffmane Version	01.001088

13. In the HFL update tool, the **Open Update Package** window pops up when the Bluetooth pairing process is complete. The HFL update tool automatically determines which version of the HFL software is present. The compatible updates will be displayed on the HFL update tool.

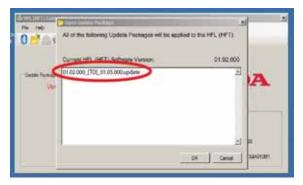

14. Click **OK** to begin the HFL control unit reflash process.

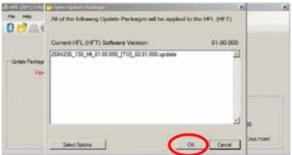

NOTE: If the HFL software is current and no update is required, the following notification appears on the HFL update tool.

	The vertex is closes and record are optimize at this is	>	10 M
	Current HPL (HPT) Schwere Verseau	02.01.000	
Lipoten Parinapa Silpin			
			5
	- See Seco	Center 2	ACT AND

15. The HFL reflash process begins. Allow several minutes for the programming to complete. The blue bars indicate the programming status and progression.

NOTE: Do not turn the engine OFF while the HDS laptop is transferring files to the HFL control unit. Doing so will damage the HFL control unit. If the Bluetooth connectivity between the HDS laptop and the HFL control unit is lost, the ignition must remain ON. Reboot the HDS laptop and restart the HFL update tool. Make sure you use the four-digit PIN you wrote down.

CONTRACTOR OF CONTRACTOR		
Pin rein		
01240		
Ø	HE'L (HE'T) Cause	and a second
	her be draw	
Updes Paskaje		
Applying Up	dates.	
1244-03 area	10 C C	
Children Annance		
and the second se		L BATI
Devricating Flat	1.	HandoFreeCirik_5526
Developing Flor		Hands/TaskLink_5526
Devicebry Flar	e1	

16. In the HDS laptop, a pop-up window alerts you when the reflash process is finalizing, and then another pop-up informs you that the reflash process has completed.

0/40	HEL (HET) Da	transformed in the second second	
Jointe Partneys	territoria (Antonio)		
Lipter	A DESCRIPTION OF A DESC	S 2002	
Name and Address of States	The HPL (HPT) is finalizing the s	chears updates, these	
Index Western			
nettering film		VIENDER PRACTING STOLES	

17. In the HFL update tool, click **OK** when the pop-up window indicates the reflash process is complete.

NOTE: Failure to wait for the HDS laptop message **Updates Complete** to display before turning the ignition OFF will interrupt the HFL programming and will damage the HFL control unit.



 The HDS laptop will indicate the update is complete, and automatically disconnects the Bluetooth connection from the HFL control unit. Close the HFL update tool by clicking on the X in the upper right hand corner.

0-76.0	-	-
	CIEL DETUNIS	(units) in the second
Update Facture Updates O	- Langer	
Jodata Versoni	SC 21 AM	
Contracting Files	#17	HE OF TILLING

19. The vehicle's audio screen will indicate the HFL update has been completed.

NOTE: Selecting **OK** will return to the **HFL** screen which will not show the newly updated software version.



20. Turn the ignition OFF and wait 10 seconds before continuing to step 21.

- 21. Turn the ignition switch to ON (II).
- 22. Wait for the audio unit to boot up. When the disclaimer screen appears, press and hold the VOL, the DISP, and the BACK buttons for at least 5 seconds until the **Select Diagnosis Items** screen appears.
- 23. Select Self-Diagnosis Mode.
- 24. The **System Links** screen appears and does an automatic diagnostic check. Wait a few moments while the process completes. Once completed and the message **Press any icon if you want to see details** appears, select **HFL**.
- 25. On the HFL screen, verify the software is updated.


HFL	<u>, r - 2000 m</u>
HFL	OK
GA-NET	OK
USB	OK
Physical Address	86
S/W Version	02.01.000
Part Number	39770T2AA715M1
	Reflash

HFL CONTROL UNIT UPDATE PROCEDURE

Vehicles with Touchscreen Navigation

NOTE: Failure to follow the procedures and precautions in this bulletin may damage the HFL control unit.

- 1. Connect a battery charger to the vehicle and leave it connected during the entire procedure to maintain a steady voltage.
- 2. Turn the ignition switch to ON (II).
- 3. Wait for the navigation system to boot up. When the disclaimer screen appears, press and hold the MENU the NAV, and the BACK buttons for at least 5 seconds until the **Select Diagnosis items** screen appears.
- 4. Select Self-Diagnosis Mode.

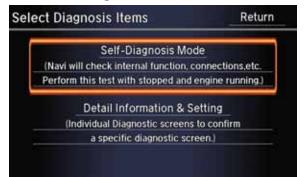

5. The **System Links** screen appears and does an automatic diagnostic check. Wait a few moments while the process completes. Once completed and the message **Press any icon if you want to see details** appears. select **HFL**.



 On the HDS laptop, double-click the HFL (HFT) Control Unit Update icon to launch the HFL (HFT) Control Unit Update tool window(HFL update tool).

NOTE: The HDS laptop must be connected to an AC outlet during the reflash process and must be within a distance of 21 feet to the vehicle. Do not allow the HDS laptop to go into sleep or hibernate mode during the reflash process. If this occurs, the Bluetooth connectivity between the HDS laptop and the vehicle's HFL system will be dropped, and the reflash process will be interrupted. It will then be necessary to restart the reflash procedure. See your laptop manufacturer's instructions or your system administrator for assistance to change these settings.

The rep	
0-740 mm	T) Net Connected
Salata Pashap Sijohin Pashape Net Selected	HELEFTS

7. On the **HFL** screen, select **Reflash**. The HFL system enters its reflash readiness mode.

NOTE: If the **HFL** is **NG** the **Reflash** button will be grayed out, and you will not be able to complete the HFL Control Unit Update Procedure. Troubleshoot for and repair any audio DTCs before continuing.

HFL	Return
HFL	ОК
GA-NET	ок
USB	ок
Physical Address	8E
S/W Version	01.06.000
Part Number	39770T2AA514M1
	Reflash

8. The HFL software update screen displays a fourdigit PIN code.

NOTE:

- This PIN code is required to complete the HFL update. Write this PIN down.
- If the PIN is not visible, use T/N 07AAZ-T2J100 to update the navigation unit. See AUDIO NAVIGATION UNIT UPDATE, page 14.



 In the HFL update tool, click on the Bluetooth icon in the upper left corner of the screen to pair with the vehicle's HFL

0100	Married	<u>8</u>
1 Sec. 7	L (HFT) Not Consecuted	-
- Lander Pauloge - Lightern Pauloge Med Robertool	HAL BUTS	

NOTE: If an active Bluetooth adapter is not found on the HDS laptop, this error message will appear. Review the REQUIRED TOOLS AND EQUIPMENT section of this service bulletin for a recognized Bluetooth device. Contact you IT support for additional help.



10. In the HFL update tool, the **Pair with HFL** window pops up. Wait a few seconds for the display to show **All Detected Bluetooth Devices**. If no devices are found after about 30 seconds, click **Refresh**.

Contra transmission	Net 11, 1911; Denice Found	
Internet	Deter Sam	
	Pite The Street	


11. In the HFL update tool, once the Bluetooth device has been detected, enter the four-digit PIN code from the vehicle's display screen into the lower left hand corner of the pop-up window. Click **Pair** to begin the pairing process.




12. Wait for the HFL update tool to complete the Bluetooth pairing process.




13. In the HFL update tool, the **Open Update Package** window pops up when the Bluetooth pairing process is complete. The HFL update tool automatically determines which version of the HFL software is present. The compatible updates will be displayed on the HFL update tool.

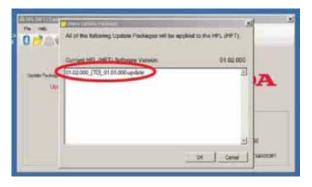

14. Click **OK** to begin the HFL control unit reflash process.

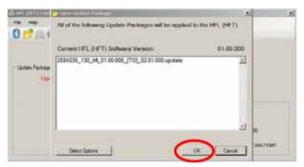

NOTE: If the HFL software is current and no update is required, the following notification appears on the HFL update tool.

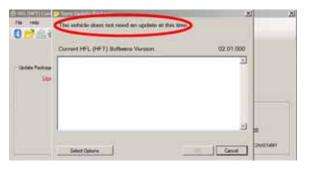

15. The HFL reflash process begins. Allow several minutes for the programming to complete. The blue bars indicate the programming status and progression.

NOTE: Do not turn the engine OFF while the HDS laptop is transferring files to the HFL control unit. Doing so will damage the HFL control unit. If the Bluetooth connectivity between the HDS laptop and the HFL control unit is lost, the ignition must remain ON. Reboot the HDS laptop and restart the HFL update tool. Make sure you use the four-digit PIN you wrote down.

andsPresiLink_0568
Leftwan Variant 01 DC 000

16. In the HDS laptop, a pop-up window alerts you when the reflash process is finalizing, and then another pop-up informs you that the reflash process has completed.

	HFL (HFT) CI	industrial .	
1.			
Update Parmage	ACT AND ADDRESS		
Upday	The FPL (1977) is fealing the	Software up drawn Planna	
Quildes Versions	-	en de la companya de	
Doubleaking Have			
		nenserveecod	0000
		HAT, HAT) Safesare Unexert.	

17. In the HFL update tool, click **OK** when the pop-up window indicates the reflash process is complete.

NOTE: Failure to wait for the HDS laptop message **Updates Complete** to display prior to turning the ignition OFF will interrupt the HFL programming and will damage the HFL control unit.

000		
	HFL (HFT) Connected	
Under Techage	la l	
Ups	Rear do the following:	
(John Versori	Turn grater off for 10 seconds. No ender this diagnosts made and confern the software version a	
Double by Nes	368	
the state of the s		

 The HDS laptop will indicate the update is complete, and automatically disconnects the Bluetooth connection from the HFL control unit. Close the HFL update tool by clicking on the X in the upper right hand corner.

	Cier petis	at Carrected	
Updotes Co			
Ladale Version	GC 01.000	H5.8411	
Developing Nex	#17	HFL (HFT) Unknown	
Aphre Ter	ui 17		



19. The vehicle's navigation screen will indicate the HFL update has been completed.

NOTE: Selecting **OK** will return to the **HFL** screen, which will not show the newly update software version.



- 20. Do the following to confirm that the software in the HFL control unit has been updated:
 - Turn the ignition OFF.
 - Wait 10 seconds, then repeat steps 2 through 5 to place the audio system in self-diagnosis mode.

AUDIO NAVIGATION UNIT UPDATE

NOTE: If you are not able to view the PIN number, use T/N 07AAZ-T2JA100 to update the audio-navigation control unit.

Vehicles with Touchscreen Navigation only

- 1. Connect a battery charger to the vehicle and leave it connected during the entire update procedure to maintain a steady voltage.
- 2. Press the engine start/stop button to select the ON mode.
- 3. In the center console, install the USB update device.

Accord



Crosstour




4. The navigation screen and the touch screen will shut off for about 10 seconds and reboot with the notification below on both screens.



5. The software update will begin. A **Notification** screen loading bar will display on both the navigation and the touch screens. *Navigation screen*



Touch screen

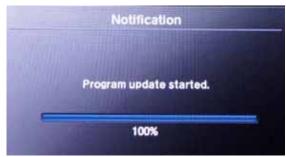

NOTE: The software update takes about 30 minutes to complete.

- Update Order:
- 1. ERATO
- 2. SH-BOOT
- 3. SH-IPL
- 4. SH-NK
- 5. Utility
- 6. BUuCOM

On the touch screen, the progress bar will stop at 100% after ERATO is updated and remain at 100% throughout all SH and Utility updates. The progress bar will go back to 0% and resume when the BUuCOM update starts.

6. When the update is complete, the system will reboot to the Hondalink screen, then the **Enter code** screen will appear.

7. When the **Enter code** screen displays on both the navigation and the touch screens, press and hold the power button for 2 seconds until you hear the beep.


Navigation screen



Touch screen



8. The navigation display will show the GPS initialization screen.

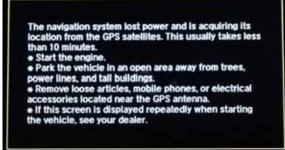

9. Press and hold the NAVI, MENU and CANCEL buttons until the **Select Diagnosis Items** screen appears.



10. Select Detail Information & Setting.



- 11. Select Version.
- 12. Verify the software was updated to the new version by making sure the SH Flash, SH HDD, ERATO IPL, ERATO APP, and BU uCOM APP match the screen below.

Navigation Display

Version			Return
Program SH Flash HDD USB Disc	1.00.2030 1.00.2030	IPL DBOOT HDD DSP	3.200.230 4.014.121 4.009.019.1201
ERATO IPL APP BU uCom	01.10.D001 01.10.D001	Model Coverage	тгаа Ка
APP	1.10A		DownLoad

- 13. Remove the USB update device.
- 14. See Vehicles With Touchscreen Navigation, page 10.