

SB-10054998-4055

Countries:	CANADA, UNITED STATES, PUERTO RICO	Document ID:	IK1500038
Availability:	ISIS, FleetISIS	Revision:	3
Major System:	FUEL SYSTEMS	Created:	4/24/2008
Current Language:	English	Last Modified:	1/23/2014
Other Languages:	Français , Español ,	Author:	Frank Amstadt
Viewed:	273		

[Less Info](#)

Hide Details

Coding Information

Copy Link	Copy Relative Link	Bookmark	Add to Favorites	Print	Provide Feedback	Helpful	Not Helpful
		 View My Bookmarks				 40	 44

Title: 8600 Front Spring Shackle Contacting Fuel Tanks**Applies To: 8600 TranStar Models Only****DESCRIPTION**


Rear shackle of steer axle spring suspension contacting fuel tank when unit is in use

SYMPTOMS

Damage to fuel tank.


TROUBLESHOOTING

1. Verify that there is a least 20mm or more of clearance between the spring shackle and front of fuel tank

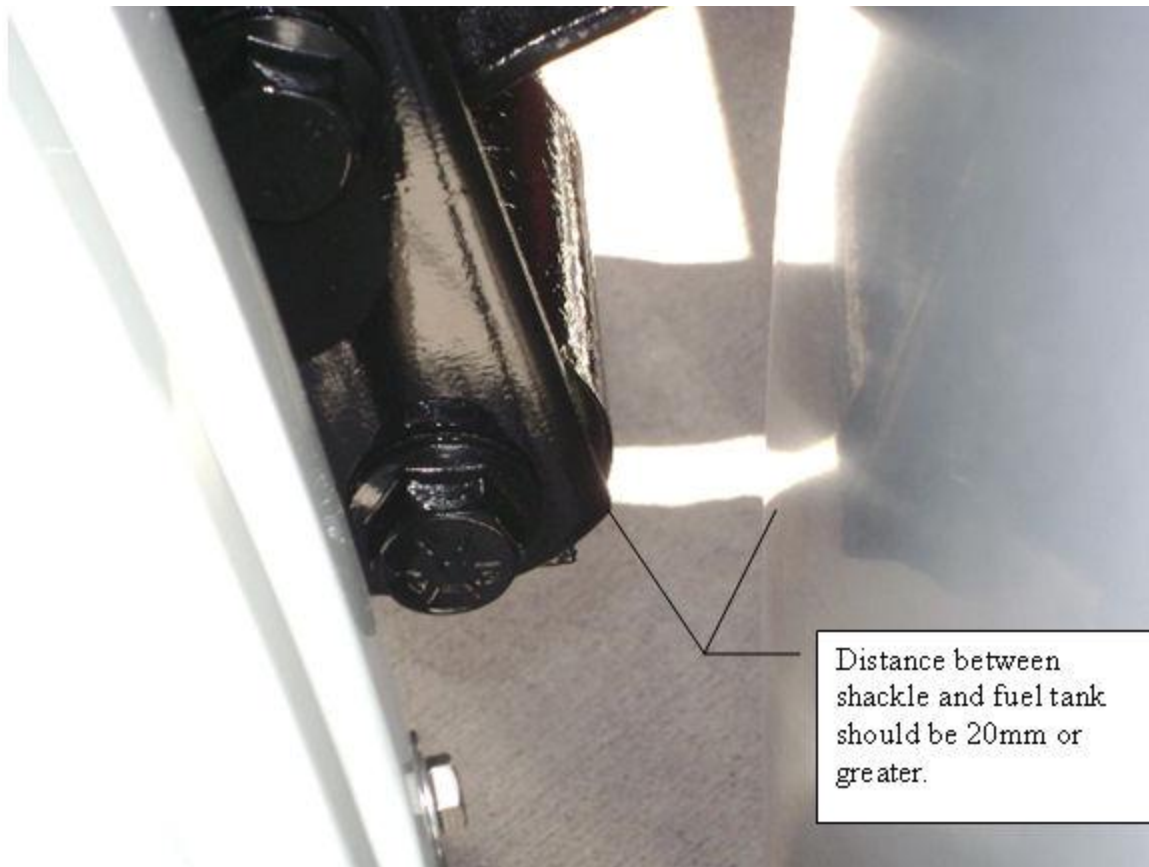

RESOLUTION

Loosen tank straps and move tank toward rear of vehicle to achieve a minimum of 20mm of clearance. Make sure tank straps are properly positioned and retorque to 37 to 45 ft lbs.

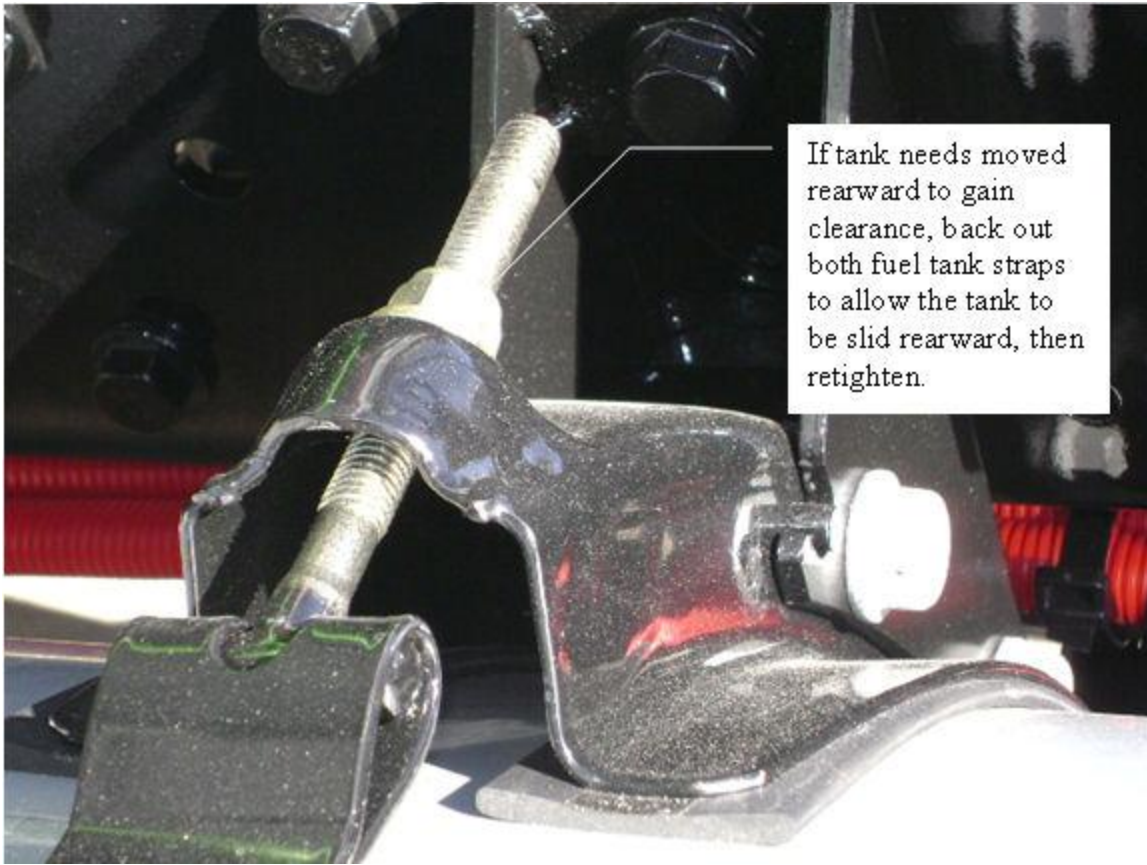

 Hide Details

Feedback Information

Viewed: 272
Helpful: 40
Not Helpful: 44

No Feedback Found