

SB-10055015-9739

FORD:

2013 C-MAX , Fusion

LINCOLN:

2013 MKZ

This article supersedes TSB 13-11-11 to update the Service Procedure.

ISSUE

Some 2013 C-MAX, Fusion/MKZ Hybrid and Energi vehicles may exhibit the check engine lamp, and/or wrench lamp, and/or red triangle lamp illuminating accompanied by various diagnostic trouble codes (DTCs).

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

1. Do you have any of the following DTCs: P0053, P01EB, P0400, P0505, P0600, P061A, P062C, P06B8, P0B0D, P0C28, P0C29, P0C2A, P1124, P175A, P2610, U1011?
 - a. Yes - one or more of the DTCs are present. Reprogram the powertrain control module (PCM) to the latest calibration using IDS release 88.03 and higher. Calibration files may also be obtained at www.motorcraft.com.
 - (1) At the Module Reprogramming screen in the IDS service tool, select Program PCM. By selecting the PCM the update will be applied to the appropriate modules as required by the software update.
 - b. No - this article does not apply. Refer to the Workshop Manual (WSM) or Powertrain Control/Emissions Diagnosis (PC/ED) manual for normal diagnostics.

OPERATION	DESCRIPTION	TIME
140020A	2013 C-MAX, Fusion And MKZ Hybrid/Energi: Reprogram The Appropriate Modules As Required By The Software Update Includes Time To Clear Codes After Repair (Do Not Use With Any Other Labor Operations)	0.5 Hr.

WARRANTY STATUS:

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage
Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

DEALER CODING

BASIC PART NO.	CONDITION CODE
RECALEM	04

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supercede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.