

ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM FOR JANUARY 2014

SB-10055023-5474

44358 2014 F-Super Duty 6.7L Built On Or After 10/01/13 DTCs P246F, P246E, P242A, P22FF, P2080, P2084, P242B, P2470, P2031, P0544 - EGT Sensor And Connector Replacement.

Some 2014 F-Super Duty vehicles equipped with a 6.7L Diesel engine and built on or after 10/01/2013 may exhibit DTCs P246F, P246E, P242A, P22FF, P2080, P2084, P242B, P2470, P2031, P0544. When diagnosing any of these DTCs, if normal PC/ED diagnostics lead to replacement of an EGT sensor, replace the sensor and the corresponding connector on the wire harness using pigtail kit (3U2Z-14S411-BXAB). During sensor/connector replacement do not disconnect the sensor from the main harness. Replace the sensor and connector as an assembly.