

**ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM
FOR JANUARY 2014**

SB-10055057-1985

44360 2013 C-Max, 2013-2014 Escape And Focus - Body Control Module Ground, DTC U3008:13

Some 2013 C-Max, 2013-2014 Focus vehicles built on or before 7/10/2013, 2013-2014 Escape vehicles built on or before 9/23/2013 may exhibit DTC U3008:13 in Body Control Module (BCM). If DTC present, a BCM ground issue exists and must be given priority over other DTCs-symptoms. A poor ground can cause low voltage to BCM, which could cause erratic, intermittent operation of several electrical components. Check ground circuits G107, G301 on Focus and C-Max, G103 and G200 on Escape. To verify integrity of ground circuits, use a suitable bulb to place load on circuits, measure voltage drop. With load present, manipulate wiring harness to check for intermittent fault. Repair circuit that drops greater than 0.3 volts and re-test. Check pin fit in all BCM connectors with a flex probe. BCM replacement will result in repeat repair if ground issue is left unresolved.