


# SB-10055337-8192

 <b>HYUNDAI</b>   NEW THINKING. NEW POSSIBILITIES. <b>Technical Service Bulletin</b>	GROUP CAMPAIGN	NUMBER 14-01-005
	DATE JANUARY 2014	MODEL GENESIS COUPE (BK)
SUBJECT: GENESIS COUPE (BK) 2.0L TURBO ECM UPDATE (SERVICE CAMPAIGN TS1)		

## **ECU Update**

### ★ IMPORTANT

#### \*\*\*\*\*DEALER STOCK AND RETAIL VEHICLES\*\*\*\*\*

Dealers must perform this Campaign on all affected vehicles prior to customer retail delivery and whenever an affected vehicle is in the shop for any maintenance or repair.

When a vehicle arrives at the Service Department, access Hyundai Motor America's "Warranty Vehicle Information" screen via WEBDCS to identify open Campaigns.

#### Description:

This bulletin provides an ECM update to revise the logic for acceleration feel at cold engine condition.

#### Applicable Vehicles:

- 13 MY Genesis Coupe (BK) 2.0L Turbo-MPI vehicles
- Production Date: January 19, 2012 ~ August 31, 2012

#### GDS Information:

EVENT #	DESCRIPTION
285*	"13MY BK FL 2.0 COLD ACCELERATION LOGIC IMPROVEMENT."

(\* the latest event that shows up in the Engine Auto Mode event list for the particular vehicle/engine)

#### Warranty Information:

Model	Op Code	Operation	Op Time
GENESIS COUPE (BK)	30C086R0	ECM UPGRADE	0.3M/H

Note: Submit claim on Campaign claim entry screen.

**SUBJECT:**

**GENESIS COUPE (BK) 2.0L TURBO ECM UPDATE  
(SERVICE CAMPAIGN TS1)**

**ROM ID INFORMATION TABLE:**

Model	Engine	ECM P/N	IMMO	ECM ROM ID	
				Previous	New
GENESIS COUPE (BK)	2.0 T-MPI	39122-2C050	Yes (push button start)	KCC0R71A KCC0R71B KCC0R71C	KCC0R80A
		39122-2C060	No (key start)	KCC0M71A KCC0M71B KCC0M71C	KCC0M80A

**GENERAL PRECAUTIONS:**

- Connect the USB cable between the GDS and the VCI.
- Connect the 16-pin DLC connector from the VCI into the DLC located under the driver's side dash.



**\* NOTE**

Make sure the battery icon at the bottom right of the GDS laptop shows at least 50%; if not, charge the GDS or attach a battery charger.

- Turn off all lights (Do not leave the headlight switch in auto mode) and all accessories (including heater/air conditioner/fan, audio, heated seats, rear defroster, etc) to ensure the battery will not be discharged during the update.
- Perform the update with the ignition key in the ON position.
- Do not disconnect any cables connected to the vehicle or the GDS during the update.
- Do not start the engine or turn the ignition switch OFF during the update.

**\* NOTE**

Confirm your GDS has the most recent version. If not, connect the GDS to an Internet port, open the GDS home page and select "Update". Refer to instructions on [hmaservice.com](http://hmaservice.com) if necessary.

If you encounter GDS related problems, call the GIT Helpline at 888-437-0308.



**SUBJECT:**

**GENESIS COUPE (BK) 2.0L TURBO ECM UPDATE  
(SERVICE CAMPAIGN TS1)**


**SERVICE PROCEDURE:**

**GDS AUTO MODE ECM UPDATE PROCEDURE**

1. From the GDS home page, select **ECU Upgrade**. If necessary, select the VIN.
2. Select **Engine** as the system and then select **OK**.
3. Select **Auto Mode** and then select **Next**.
4. From the **System** tab, select **Engine** and then select **OK**. The GDS will read the ROM ID. Confirm the ROM is applicable as shown on Page 1, "ROM ID Information".



5. Select update event as listed on the **GDS Event list of page-1**. Select **Upgrade**.

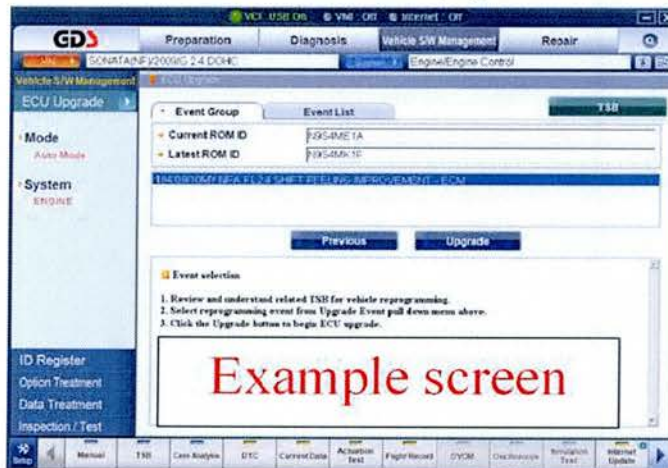

6. If the screen indicates "**Voltage is OK**" (voltage > 12volts), select **OK**. If not, select **CANCEL** and charge the vehicle battery by running the engine for 10 minutes, then attempt update again.
7. Updating will occur until 100% is reached on the bar graph. At the prompt, turn the ignition key OFF for 10 seconds, then turn it ON and select **OK**.
8. The GDS will confirm that ECM reprogramming is successfully finished. Select **OK**.
9. If the ECM update was not successful, go to **GDS MANUAL MODE ECM UPDATE PROCEDURE**.
10. Check for DTC in all systems and Erase All DTC that stored due to loss of CAN communication during the ECM Update.
11. Turn **OFF ignition 10 seconds** then turn **ON** before going to engine start.

**\* IMPORTANT STEP**

**NOTE: ETC Learning Procedure requires turning ON ignition for 5 seconds with engine not running, after the ECM Update finishes and Step-11.**



**SUBJECT: GENESIS COUPE (BK) 2.0L TURBO ECM UPDATE  
(SERVICE CAMPAIGN TS1)**

12. **ETC Learning Procedure - IMPORTANT:**  
Turn **ignition ON with engine not running for 5 seconds** then turn off ignition.
13. Start the engine to confirm proper operation.
14. Clear DTC in the BlueLink system per instructions of TSB 12-BE-005-2.

**\* NOTE:**

**In event of AUTO MODE update failure:**

- You must attempt **MANUAL MODE**. Use the ECM P/N from the vehicle's ECM label if it is not clear from the ROM ID Table as to the correct ECM P/N to use for your vehicle.
- If **MANUAL MODE** update attempt also failed, then create a GDS screenshot with the error message before proceeding.
- The printed copy of this GDS error screenshot must be attached to the Repair Order as evidence to prevent a potential warranty chargeback.

**GDS MANUAL MODE ECM UPDATE PROCEDURE**

**\* NOTE**

- GDS Manual Mode is intended for recovery of an ECM Update should it begin but then later fail in process in the Auto Mode.
- The ECM connectors must be disconnected for 15 minutes to reset its contents then perform this Manual Mode Update.
- Do not force Manual Mode if you get an error in Auto Mode that the vehicle's current ROM ID did not apply.
- It is critical to identify the correct ECM Part Number in the **PASSWORD** table or the ECM may be permanently damaged. It is recommended to remove ECM and read the part number from the label to confirm.

1. From the GDS home page, select **ECU Upgrade**. If necessary, select the VIN.
2. Select **Engine** as the system and then select **OK**.
3. Select **Manual Mode** and then select **Next**.
4. From the **System** tab, select **Engine** and then select **OK**.
5. Select update event as per the **GDS Event List of page-1**, then select **Upgrade**.
6. Be certain to enter the exact appropriate password from the table below and select **OK**. **See the important NOTE above.**
7. The remaining steps are same as Steps 6~14 of the Auto Mode Procedure.

MENU	PASSWORD
BK FL 2.0 IMMO : 39122-2C050 (Push button Start)	2050
BK FL 2.0 NON IMMO : 39122-2C060 (Key Start)	2060