

ONLINE AUTOMOTIVE SERVICE INFORMATION  
FOR MARCH 2014

**SB-10055363-3773**

44440 2013-2014 C-MAX Hybrid/Energi vehicles - Pull During Braking

2013-2014 C-MAX Hybrid/Energi vehicles may exhibit a slight drift to the left during low speed regenerative braking. Inspect and inflate tires to correct cold pressure as listed on placard. Inspect the tires for abnormal wear or damage per Workshop Manual, Section 204-00. If condition still exists, it may be further minimized by reducing camber on the left front wheel and increasing camber on the right front wheel. Do not exceed the maximum left to right camber split of - 0.3 degrees or published camber specification limits. Refer to the Workshop Manual, Section 204-00 for camber adjustment procedures and published Service Labor Time Standards.