


SB-10055384-4388

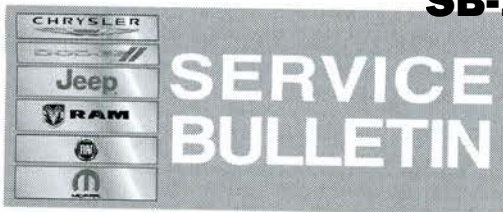

NUMBER: 07-001-14

GROUP: Cooling

DATE: February 15, 2014

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 14-013. ALL APPLICABLE SOLD AND UN-SOLD RRT VIN'S HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.

SUBJECT:

Intermittent Engine Cooling Fan Operation

OVERVIEW:

This bulletin involves an inspection of the Engine Cooling Fan Module and replacement if necessary.

MODELS:

2014 (JK) Wrangler

NOTE: This bulletin applies to vehicles built on or after August 8, 2013 (MDH 0808XX) and on or before August 18, 2013 (MDH 0818XX).

SYMPTOM/CONDITION:

The customer may experience an engine overheat condition or lack of cooling from the air conditioning system.

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair. For all other customers that describe the symptom/condition, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1	68143894AB	Module, Engine Cooling

REPAIR PROCEDURE:

1. Inspect the barcode label affixed to the rear of the engine cooling fan motor.
2. Does the label indicate "Made in USA" (Fig. 1)?
 - a. Yes>>> Proceed to Step 3.
 - b. No>>> Repair complete.



Fig. 1 Barcode Label

1 - Manufacturing Location

-
3. Replace the Engine Cooling Fan Module Assembly. Refer to the detailed removal and installation procedures available in DealerConnect> TechConnect> Service Info> Cooling> Engine> Fan, Cooling> Removal/Installation.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
07-15-01-90	Cooling Fan, Inspect Only (1 - Semi-Skilled)	7 - Cooling	0.2 Hrs.
07-15-01-91	Cooling Fan, Inspect and Replace (1 - Semi-Skilled)	7 - Cooling	0.3 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------