



**SB-10055490-3492**

---

**SERVICE BULLETIN**

---

Classification:

EL14-009

Reference:

NTB14-026

Date:

April 9, 2014

---

**2008 – 2014 ROGUE; MAIN HARNESS TO BODY HARNESS  
ELECTRICAL CONNECTOR CORROSION**

**APPLIED VEHICLES:** 2008 – 2013 Rogue (S35)  
2014 Rogue Select (S35)

**IF YOU CONFIRM:**

An electrical issue caused by corrosion in the Main Harness to Body Harness connectors located at the bottom of the driver side A-pillar.

- Connector numbers M13 to B3 and/or M14 to B4.

**NOTE:**

- Examples of electrical issues that may occur are; power seat inoperative, power windows inoperative, radio inoperative, horn sounds on its own, etc.
- See Figure 1 on page 2 for connector location.

**ACTIONS:**

1. Perform repairs to harness connectors as needed.
2. Apply "Harness Protector" to cover the harness connectors.

**IMPORTANT:** The purpose of "ACTION" (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire Service Procedure as it contains information that is essential to successfully completing the repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

## Main Harness to left side Body Harness connector location

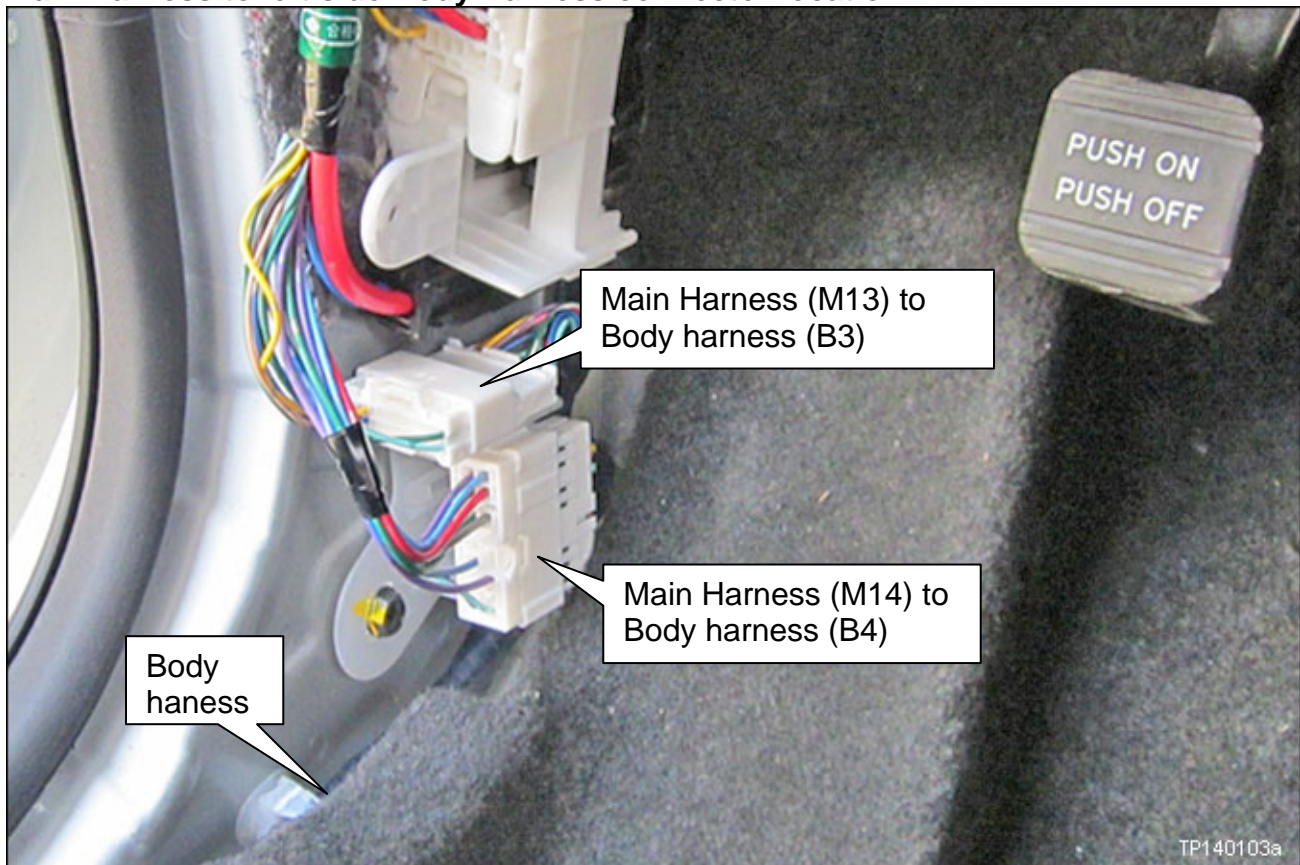


Figure 1

## SERVICE PROCEDURE

1. Inspect connectors M13, M14, B3, and B4.
2. Perform repair to the connectors as needed.
  - Use harness repair kit J-48817 as needed to perform repairs.  
**NOTE:** For instructions on using harness repair kit J-48817, refer to **ASIST >> Tech-Mate >> Tech-Mate Tools & Equipment >> Harness Repair Kit User Guide.**
  - If necessary, replace the Main Harness and/or Body Harness:  
**NOTE:** If needed, refer to the Electronic Service Manual (ESM) for harness replacement information.
  - During harness repair, cover connectors M13/B3 and M14/B4 with harness protector (see Figure 2 on the next page).

- During harness repair, cover connectors M13/B3 and M14/B4 with harness protector as shown.
- Harness protector is listed in the Parts Information.
- Two protectors come in the package, only one is needed.



Figure 2

## PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
Harness Protector (package contains 2 protectors, only one will be needed)	24271 – ZW40A	1

## CLAIMS INFORMATION

Submit a Primary Failed (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
REPAIR WIRING HARNESS	(1)	RA16AA	ZE	62	(2)

(1) Refer to the electronic parts catalog (FAST) and use the Body harness part number (24010-\*\*\*\*\*) as the Primary Failed Part (PFP).

(2) Straight time operation code, bill for actual clocked time only.