

SB-10055635-6151

**ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM
FOR FEBRUARY 2014**

44396 2013 - 2014 Expedition and Navigator Produced On Or Before 1/7/2014 - Charge Indicator and Possible DTCs (Diagnostic Trouble Codes) P0620, P0625, and P065B

Some 2013-2014 Expedition/Navigator vehicles produced on or before 1/7/2014 may have an illuminated charge indicator lamp and/or any of the following DTCs P0620, P0625 and P065B. This may be caused by chafing of the 14305 wire harness at the thermostat housing bolt. Please verify the integrity of the harness and repair any chafing following the repair guidelines in Section 5 of the online Wiring Diagram and secure the harness away from the thermostat housing bolt.