



# Technical Service Bulletin

---

## 94 Taillight false warning upon start (DTC 02771 or 02772 - rear light bulb M69 or M70)

94 14 33 2036653/1 March 6, 2014.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6	2014	All	Not Applicable

## Condition

- The rear taillight warning for the left or right taillight may display in instrument cluster upon vehicle start.
- The vehicle taillights are operating normally.
- One or both of the following DTCs are sporadically found in the comfort system central control module, J393 (address word 46):
  - **DTC 02771:** M69 left, outer taillight bulb, electrical fault in circuit, intermittent
  - **DTC 02772:** M70 right, outer taillight bulb, electrical fault in circuit, intermittent

## Technical Background

An intermittent taillight warning upon vehicle start may be possible in extremely cold weather, but rear light functionality is not lost. An ignition key cycle will reset the warning.

## Production Solution

Not applicable

## Service

1. Verify that the taillights operate normally.
2. Upload ODIS log of DTC(s) to GFF paperless.
3. Clear DTC(s).
4. Explain to the customer the *Technical Background* and that Audi is aware of the issue and it is currently under investigation.

## Warranty

This bulletin is informational only and is not applicable to any Audi warranty.

# Technical Service Bulletin

---



## Additional Information

All parts and service references provided in this TSB (2036653) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.