



Update Prior to Sale Notice UPS7513: Rear Suspension Upgrade

SERVICE BULLETIN

28-JAN-14

No.: 6-217NAS

Section: GENERAL
INFORMATION

Market: CAN / USA

DESCRIPTION

A limited number of 2014 model year Jaguar XJR vehicles require an upgrade to the rear suspension system to align with current production specifications. A revised design rear suspension toe link nut with integral washer will be installed and, if necessary, the currently fitted 17-mm rear stabilizer must be replaced with an 18-mm rear stabilizer bar.

AFFECTED VEHICLES

The VIN range of affected vehicles is V51872-V64807.

WORKSHOP PROCEDURES

Retailers are required to check DDW to ensure that the vehicle is affected by this program prior to undertaking any rework action. Retailers are required to **HOLD** all affected vehicles within the listed VIN range that are in their control and refrain from releasing the vehicles for new or used vehicle sale pending completion of the rework action. Affected vehicles already in the hands of customers should be updated at the next available opportunity.

Refer to Technical Bulletin UPS7513-2b: *Update Prior to Sale: Rear Suspension Upgrade*, for detailed repair instructions.

PARTS

DESCRIPTION	PART No. / SUNDRY CODE	QTY. / VALUE	EXPECTED % of VEHICLES REQUIRING PARTS*
Nut and washer assembly	C2D38498	2	100 (all VINs)
Rear Stabilizer Bar	C2P23536	1	90 (VINs V51872-V63402 only)
Bush	C2P18877	2	90 (VINs V51872-V63402 only)
Bolt	C2P7261	2	90 (VINs V51872-V63402 only)
Bolt	C2P7262	2	90 (VINs V51872-V63402 only)

△ **NOTE:** * when ordering parts, order only the expected percentage demand of parts identified

TOOLS

Refer to Workshop Manual / Service Instruction for any required tools

WARRANTY

△ **NOTE:** Repair procedures are under constant review, and therefore times / prices are subject to change; those quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time. Check DDW to ensure that the vehicle is affected by this program prior to undertaking any rework action. At the time of confirming a booking for vehicle repair, ensure that all outstanding Service Actions are identified

to ensure the correct parts are available and adequate workshop time is allocated for repairs to be completed at one visit.

Warranty claims must be submitted quoting Program Code '**K207**' together with the relevant Option Code from the table. SRO and parts information is included for information only. The Option Code(s) that allows for the drive in / drive out allowance may only be claimed if the vehicle is brought into the workshop for this action alone to be undertaken.

This program is valid for a limited time only. Warranty claims with a repair date prior to the **23 July 2014** closure date must be submitted for payment within 30 calendar days of completion of the repair.

PROGRAM CODE	OPTION CODE	DESCRIPTION	SRO	TIME (HOURS)	PART No. / SUNDRY CODE	QTY. / VALUE
K207	B	NOTE: VINs V51872-V63402 only				
		Rear stabilizer bar – Renew	64.91.19	1.30	C2P23536	1
					C2P18877	2
					C2P7261	2
K207	C				C2P7262	2
		Fit nut and washer assembly	05.10.30	0.30	C2D38498	2
		Carry out four-wheel alignment check	56.65.11	0.80	-	-
K207	C	NOTE: VINs V51872-V63402 only				
		Rear stabilizer bar – Renew	64.91.19	1.30	C2P23536	1
					C2P18877	2
					C2P7261	2
K207	D				C2P7262	2
		Fit nut and washer assembly	05.10.30	0.30	C2D38498	2
		Carry out four-wheel alignment check	56.65.11	0.80	-	-
		Drive in/drive out	10.10.10	0.10	-	-
K207	D	NOTE: VINs V63564-V64807 only				
		Fit nut and washer assembly	05.10.30	0.30	C2D38498	2
K207	E	NOTE: VINs V63564-V64807 only				
		Fit nut and washer assembly	05.10.30	0.30	C2D38498	2
		Drive in/drive out	10.10.10	0.10	-	-

Normal Warranty policies and procedures apply