

2.0L GDI - MALFUNCTION INDICATOR LIGHT (MIL) ILLUMINATED -  
CONTINUOUS MEMORY DIAGNOSTIC TROUBLE CODE (CMDTC) P0118  
- BUILT ON OR BEFORE 5/17/2013

TSB 14-0068

## SB-10055782-3167

### FORD:

2013 Focus

### ISSUE

Some 2013 Focus vehicles equipped with a 2.0L Gasoline Direct Injection (GDI) engine, and built on or before 5/17/2013, may exhibit an illuminated MIL on with CMDTC P0118 stored in powertrain control module (PCM) memory.

### ACTION

Follow the Service Procedure step to correct the condition.

### SERVICE PROCEDURE

1. Using Integrated Diagnostic System (IDS) check for CMDTCs. Is P0118 stored in PCM memory?
  - a. No - this article does not apply. Refer to the Powertrain Control/Emissions Diagnosis manual for normal diagnostics.
  - b. Yes - replace the Engine Coolant Temperature (ECT) sensor. Refer to Workshop Manual, Section 303-14.

PART NUMBER	PART NAME
7C1Z-12A648-A	Engine Coolant Temperature Sensor

OPERATION	DESCRIPTION	TIME
140068A	2013 Focus 2.0L GDI Engine: Check DTCs And Replace The ECT (Do Not Use With Any Other Labor Operations)	0.9 Hr.

### WARRANTY STATUS:

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage  
Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

### DEALER CODING

BASIC PART NO.	CONDITION CODE
12A648	42

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.