

ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM
FOR MAY 2014

SB-10056157-5717

44567 2014 F-Super Duty Vehicles Equipped With Sirius Satellite Radio - Intermittent Audio Control Module (ACM) Functions During Sirius Satellite Updates

Some 2014 F-Super Duty vehicles equipped with Sirius satellite radios may exhibit any of the following symptoms, during a Sirius satellite radio update: Radio will not turn on, Display message stating Sirius update while the 203 mm (8-inch) touchscreen freezes, CD will not eject with message saying No Disk and intermittently the 203 mm (8-inch) touchscreen locks-up during SIRIUS satellite radio updates. To correct the condition reprogram Audio Control Module (ACM) to latest calibration using IDS release 90.05 and higher. Calibration files may also be obtained at www.motorcraft.com. For warranty claiming use causal part 19C107, and applicable 12651D labor operation(s) in Section 10 of the SLTS Manual for the vehicle.