

ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM
FOR MAY 2014

SB-10056194-8008

44570 2015 F-Super Duty - 6.7L Engine - Instrument Panel Cluster (IPC) Warning Message:
Engine Idle Soon or Engine Idle Exhaust System Fault W/WO DTC's

Some 2015 F-Super Duty vehicles equipped with a 6.7L diesel engine may exhibit an (IPC) warning of: "Engine Idle Soon and/or Exhaust System Fault" with or without DTC's. To remove vehicle from this mode, prior to going into idle only mode, correct fault indicated by DTCs and follow appropriate Pinpoint Tests. Refer to updated PCED Manual Drive Cycle in Diagnostic Methods section 2. Note: If idle only condition is still present, after performing updated PCED procedure, check CMDTCs and follow appropriate PPT's for any DTC's that set. If no DTC's are present; the vehicle cannot be removed from idle mode. PCM replacement corrects condition, refer to WSM section 303-14B for repairs. In IDS Without going to (PMI) install new PCM, navigate Toolbox > Module Programming> PMI. Use available service labor time standards (SLTS) operations.