

**ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM  
FOR MAY 2014**

**SB-10056209-1128**

44557 2013 Escape - Potential FEAD Belt Mis-Installations During Service On The 1.6L GTDI.

During any related service on a 1.6L GTDI, if the Accessory Drive Belt is not positioned and installed correctly on the Accessory Drive Belt Tensioner pulley, it may contact the tensioner arm causing the belt and tensioner to overheat from friction. The heat will also transfer to the tensioner pulley causing pulley failure. Care must be taken to position and install the Accessory Drive Belt properly. Refer to Workshop Manual, Section 303-05. Note: In the event of failure of the Accessory Drive Belt Tensioner, the Accessory Drive Belt should be replaced, as well.