

**WHIRRING/BUZZ OR SAW-TYPE ENGINE NOISE AT 950-1200 RPM
AFTER COLD START - FROM TIMING BELT COVER**

TSB 14-0101

SB-10056210-6774**FORD:**

2012-2014 Fiesta

This article supersedes TSB **14-0025** to update the Service Procedure and Part List.**ISSUE**

Some 2012-2014 Fiesta vehicles equipped with a 1.6L Twin Independent Variable Cam Timing (Ti-VCT) may exhibit a whirring, buzz or saw-type noise from the engine after a cold start between 950-1200 RPM from the timing belt cover.

ACTION

Follow the Service Procedure Steps to correct the condition.

SERVICE PROCEDURE

1. Replace the Timing Belt and Timing Belt Covers. Refer to Workshop Manual (WSM), Section 303-01.
 - a. Vehicles built on or before 5/15/2012 are equipped with a three (3) piece timing belt cover. The new two (2) piece timing cover replaces these three (3) piece applications.

PART NUMBER	PART NAME
BM5Z-6019-C	Timing Belt Cover - Upper
AM5Z-6019-A	Timing Belt Cover - Lower
BE8Z-8620-A	Accessory Drive Belt w/ A/C
BE8Z-8620-BA	Accessory Drive Belt w/o A/C
XG-3-A	Motorcraft® Silicone Brake Caliper Grease and Dielectric Compound
BE8Z-6A340-A	Crankshaft Pulley Bolt
BE8Z-6268-C	Timing Belt

OPERATION	DESCRIPTION	TIME
140101A	2012-2014 Fiesta: Replace The Timing Belt And Timing Belt Cover (Do Not Use With Any Other Labor Operations)	2.6 Hrs.

WARRANTY STATUS:

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

DEALER CODING

BASIC PART NO.	CONDITION CODE
6019	42

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.