



SB-10056241-1420

File in Section: -

Bulletin No.: P11280

Date: July, 2014

Service Bulletin

PRELIMINARY INFORMATION

Subject: Service Hybrid System Message, MIL or Loss of Propulsion with DTC P1ABE, P0A7E or P0C32 Set

Models: 2009-2013 Cadillac Escalade
2009-2013 Chevrolet Silverado
2008-2013 Chevrolet Tahoe
2009-2013 GMC Sierra
2008-2013 GMC Yukon
Equipped with RPO M99

Condition/Concern

Some customers may comment that the malfunction indicator lamp (MIL) is illuminated, Service Hybrid System message displayed on driver information center (DIC) and/or loss of propulsion when the vehicle speed is less than 5 km/h (3 mph) with DTCs P1ABE, P0A7E and P0C32 set.

Recommendation/Instructions

With the ignition OFF, perform the High Voltage Disabling procedure at the drive motor generator battery. Ensure the drive motor generator battery inlet and outlet air vents do not have any obstructions or blockages.



3951923

If obstructions or blockages are found as shown in illustration above, remove as necessary. Complete Service Information (SI) for the associated Diagnostic Trouble Code (DTC).



3954984

If no obstructions are found as shown in illustration above, refer to SI and follow the diagnostic instructions.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
5080138*	Inspect Drive Motor Generator Battery Inlet/Outlet	0.2 hr
Add	Clean Drive Motor Generator Battery Inlet/Outlet and Clear DTCs	0.4 hr
*This is a unique Labor Operation for Bulletin use only. It will not be published in the Labor Time Guide.		