



SB-10056245-7775

File in Section: -

Bulletin No.: P11283

Date: July, 2014

Service Bulletin

PRELIMINARY INFORMATION

Subject: Tire Pressure Monitor (TPM) Light Flashes While Driving

Models: 2013 Cadillac SRX (Middle East Only)

Condition/Concern

Some customers may comment that the tire pressure light flashes while driving.

When checking the vehicle for DTCs, the BCM may report C0750 and/or C0755.

This condition may be caused by noise interference while the vehicle is running. The remote control door lock receiver (RCDLR) is not able to receive the TPM signal.

Recommendation/Instructions

A new remote control door lock receiver (RCDLR) has been released to correct this condition. Technicians should replace the RCDLR. Refer to the Remote Control Door Lock Receiver Replacement procedure in SI. After the RCDLR has been replaced, the BCM will need to be reprogrammed. Contact Techline for a VCI number.

Parts Information

| Part Number | Description | Qty |
|-------------|------------------------------------|-----|
| 13583333 | Receiver, Remote Control Door Lock | 1 |

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor Operation | Description | Labor Time |
|-----------------|---|------------------------------------|
| 6430260 | Remote Control Door Lock Receiver Replacement | Use Published Labor Operation Time |