

SB-10056411-3594

Reference	SSM71796
Models	XJ / X351
Title	XJ351 - IPK / TSD and Headlights Flicker
Category	Electrical
Last modified	27-Mar-2014 00:00:00
Symptom	203000 Basic Electrical
Content	<p>Issue: Customer may notice that the Instrument Pack (IPK) / Touch Screen Display TSD and Headlights flicker momentarily.</p> <p>Cause: During Active diagnostics of the Dual Battery system voltage can peak above 16v due to an internal module software issue.</p> <p>Action: Where module interrogation highlights the following code B1402-96 please carry out the following;- 1) Replace the Dual Battery Module part # C2D40918 2) Update the Gate Way Module as per Technical Service Bulletin JTB00310v3 3) Using Midtronic tester EXP-1080 test the main and auxiliary batteries and follow the instruction given.</p>