

Fault message in instrument cluster on engine start**"Power Steering Malfunction, Service Required"**

| | |
|-------------------|--|
| Topic number | LI46.35-P-059463 |
| Version | 1 |
| Design group | 46.35 Elec tric steering |
| Date | 07-22-2014 |
| Validity | Model 242 up to vehicle ident number: WD#242#### J0001389 |
| Reason for change | |
| Reason for block | |

Complaint:

Immediately after the engine is started, the instrument cluster displays the warning message "Power Steering Malfunction, Service Required". An acoustic warning sounds at the same time and the steering has excessive resistance.

Features of the problem:

Fault code C159209 logged in steering control unit N68.

Cause:

During the starting procedure, some data required for control unit monitoring may become implausible, causing the steering to switch to malfunction.

Remedy:

Please perform software update of electric power steering (N68). Software available with Xentry version 07/14.

| |
|--|
| Symptoms |
| Chassis/suspension / Steering system / Steering System Function / Support |
| Chassis/suspension / Steering system / Steering System Function / Stiff movement |

| | | |
|-----------------|--------|--------------|
| Validity | | |
| Vehicle | Engine | Transmission |
| 242.848 | * | * |
| 242.890 | * | * |