


SB-10056596-6838 Brake Drum, Replacement Steer Axle VN, VHD, VAH

FSB 511-003, Brake Drum, Replacement (Steer Axle)

(AUGUST 2014)

Some VOLVO VN, VHD, VAH trucks built between 08/29/2011 and 06/30/2014, equipped with a Rockwell or Hendrickson 14.6k steer axle, and 152 mm (6.0 in) wide Meritor brake shoes can show signs of brake shoe protrusion beyond the brake drum. This condition is resolved by installing new 152 mm (6.0 in) brake shoes, new dust shields, and new 178 mm (7.0 in) wide brake drums (20536276).

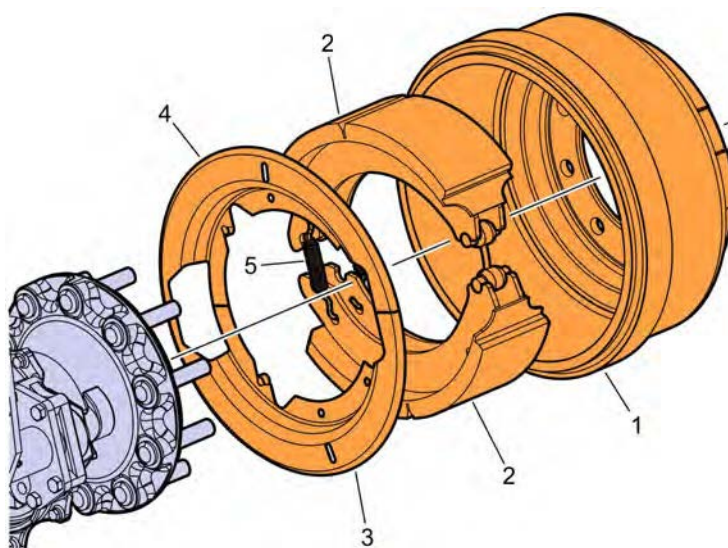

W5092261

Required Parts (Brake Drum Replacement)

Item	Description	Part Number	Qty
1	Brake Drum, 178 mm (7.0 in) wide	20536276	2
2	Brake Shoe Kit, 152 mm (6.0 in), Meritor	TDAKSMA15014715QP	2
3	Brake Dust Shield Kit, Meritor	85143647	2

Service personnel: Please circulate, read and initial


Service Manager	Warranty Administrator	Workshop Foreman	Service Technicians						

Decommissioning the Truck for Repair

You must read and understand the precautions and guidelines in Service Information, group 50, "General Safety Practices, Brakes" before performing this procedure. If you are not properly trained and certified in this procedure, ask your supervisor for training before you perform it.


NOTE: Information is subject to change without notice. Illustrations are used for reference only and can differ slightly from the actual vehicle being serviced. However, key components addressed in this information are represented as accurately as possible.

- 1 Park the vehicle on a flat and level surface.
- 2 Apply the parking brake.
- 3 Place the transmission in neutral or park.
- 4 Install the wheel chocks.

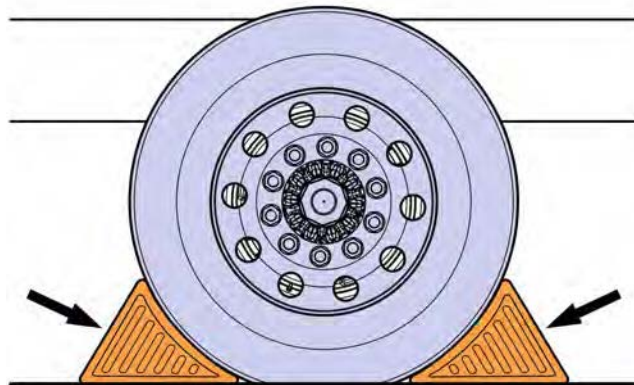

W7086748

- 5 Disconnect the cable from the battery's negative terminal.

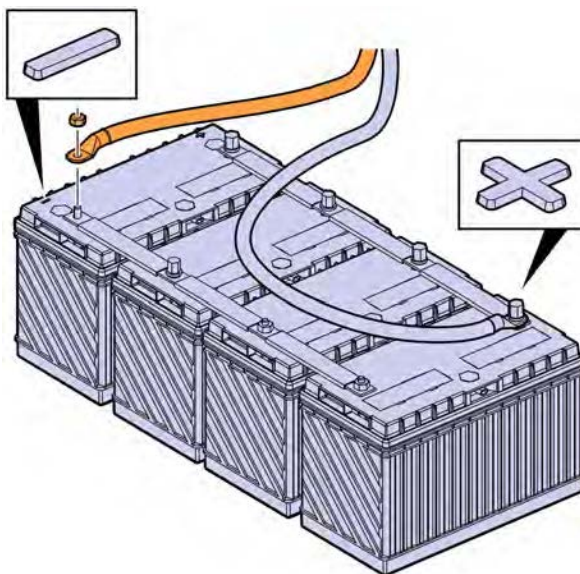


W3086747

Brake Drum, Replacement, Meritor (1.0 hrs)


Note: The left side is shown for instructional purposes.

- 1 Lift the steer axle with a jack, place the truck on jack stands, and remove the jack.
- 2 Remove the wheel nuts.

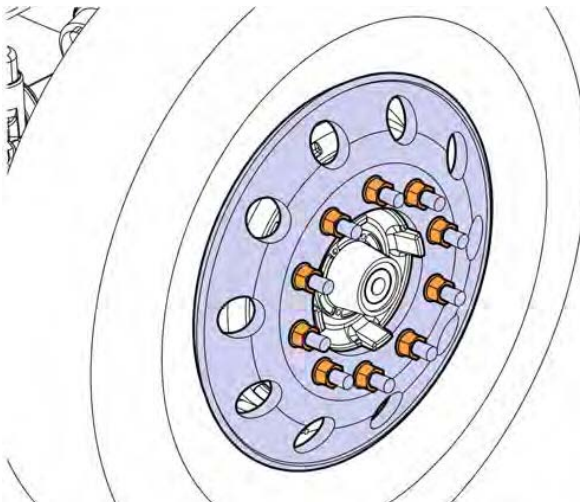


W5092265

- 3 Remove the wheel.

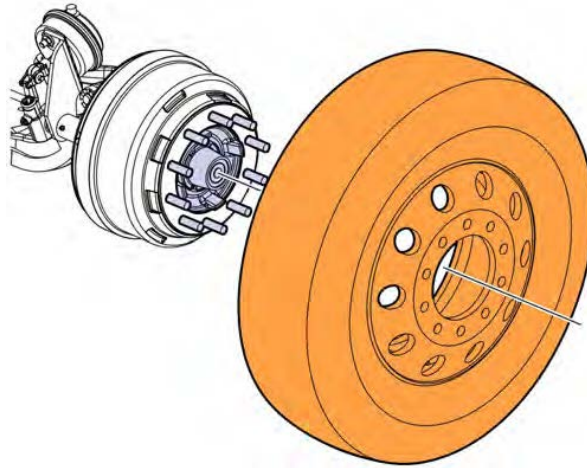


W5092266

- 4 Remove the six fasteners securing the existing dust shields.

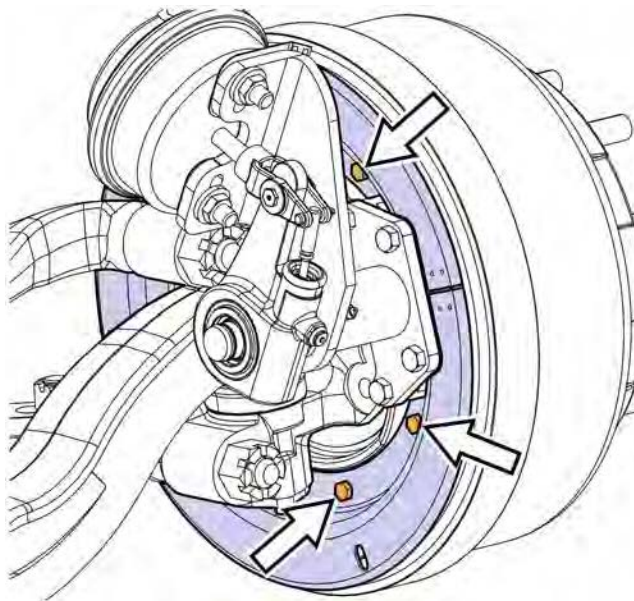

W5092654


- 5 Remove the dust shields.

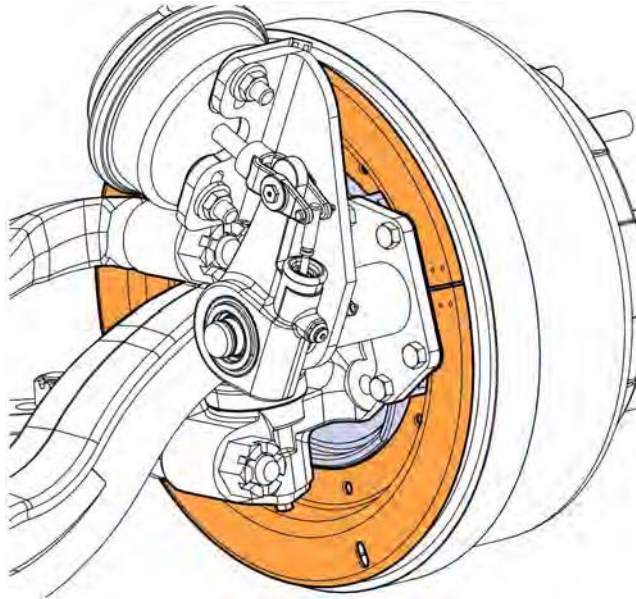

W5092655


- 6 Remove the slack adjuster pawl.

Note: The Meritor slack adjuster is shown in this procedure for backing off the brakes. However, this procedure is similar for other brands.

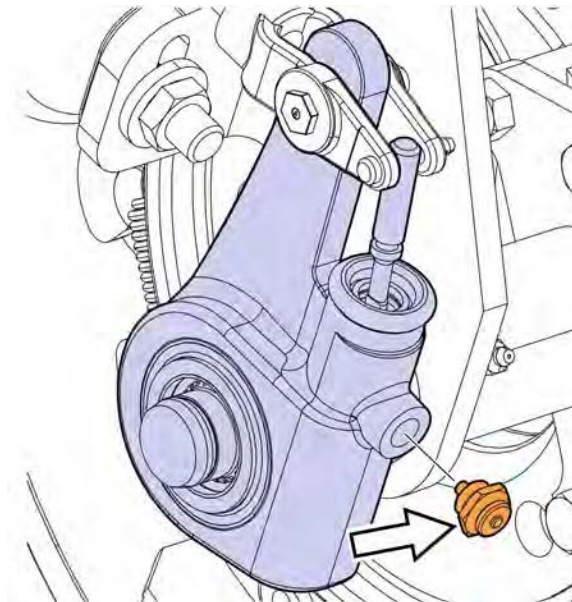

W5092267


- 7 Back off of the brake (slack adjuster).

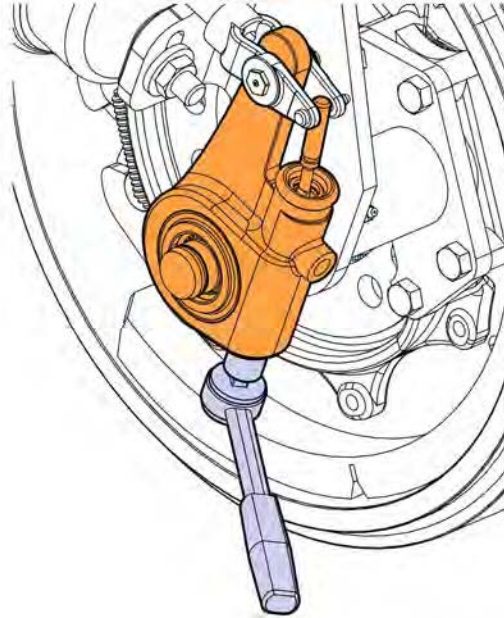

W5092270


- 8 Remove the brake drum.

Note: Discard the brake drum.

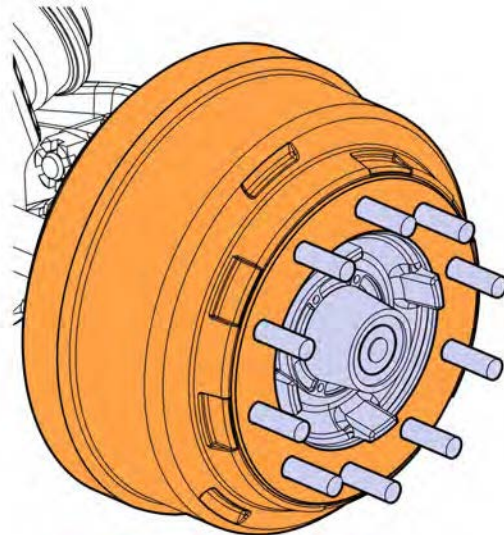


W5092271

- 9 Remove the brake shoes, brake springs, and rollers.

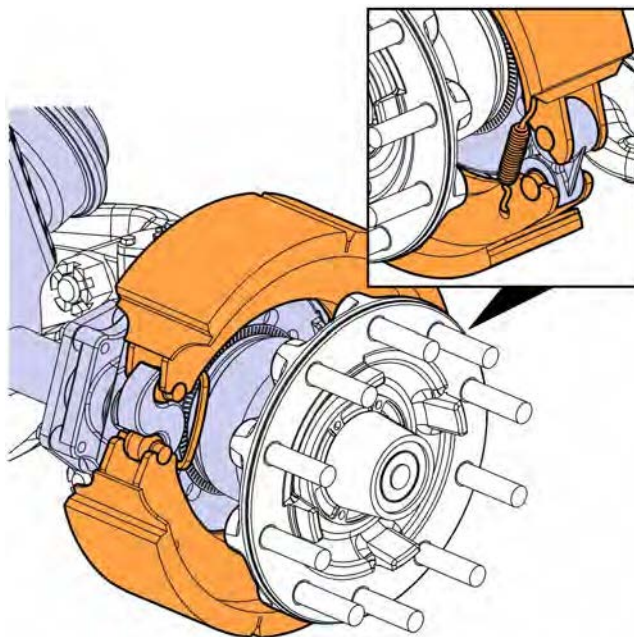

W5092272


- 10 Install the new dust shields. See the table on page 1 for the correct part numbers.

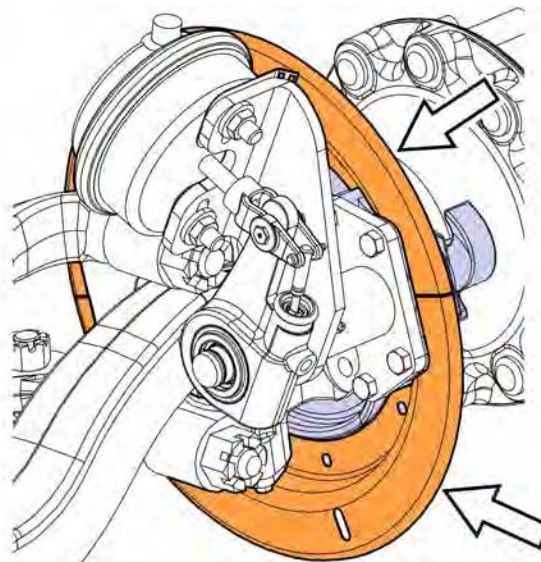

W5092273

11 Install the six fasteners securing the dust shields.


12 Tighten dust shield fasteners to 40 ± 5 Nm (29 ± 3 ft-lb).

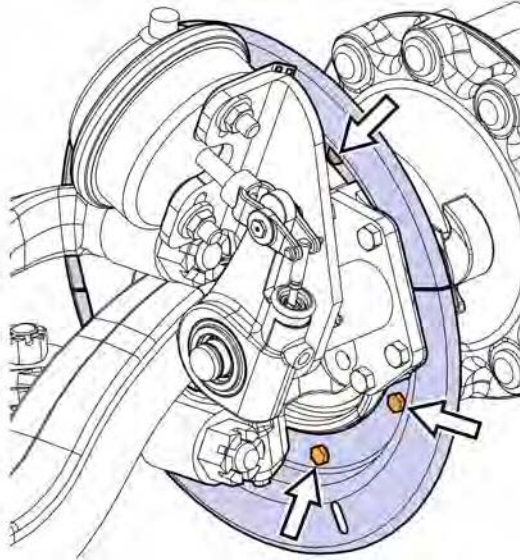

W5092274


13 Install the replacement brake shoes, springs and rollers.

Note: The brake springs and rollers are included in the brake shoe kit.

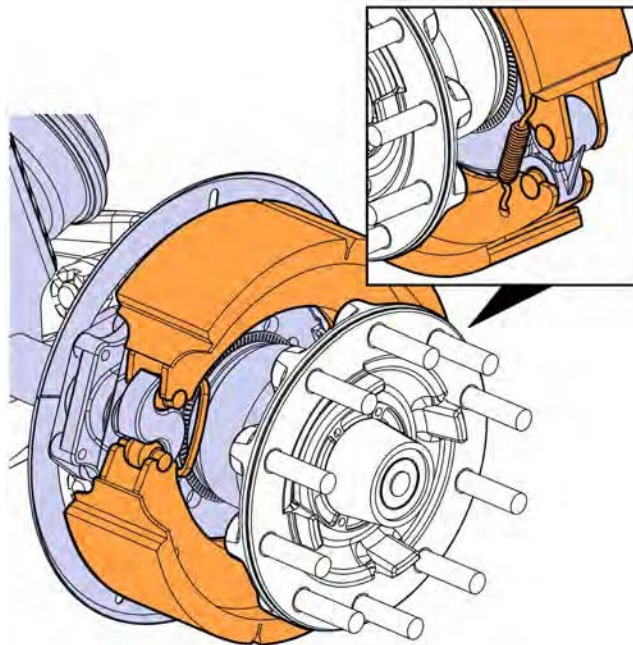

W5092275

- 14 Install the replacement brake drum (178 mm (7.0 in) wide). See the table on page 1 for the correct part number.

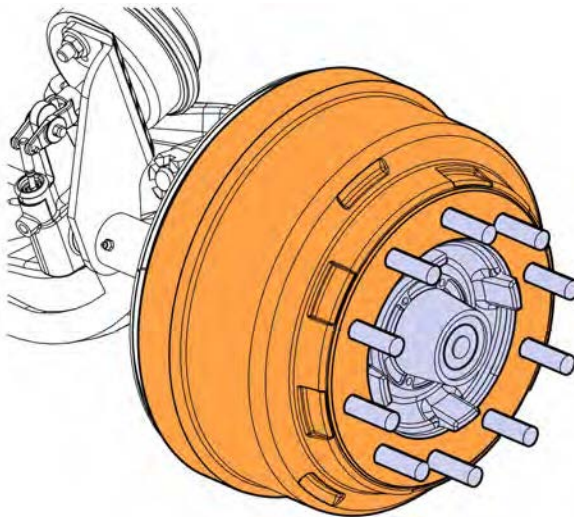


W5092276

- 15 If applicable, loosen the brake chamber clamp and re-position the clamp at a 45° angle or until proper clearance of the wheel is obtained. See figure below.

Note: Do not rotate the brake chamber. Rotate the clamp only.


Note: Ensure the brake chamber clamp does not interfere with the dust shield or Drum.

- 16 If applicable, tighten the brake chamber clamp fastener to 44 ± 4 Nm (32 ± 3 ft-lb).

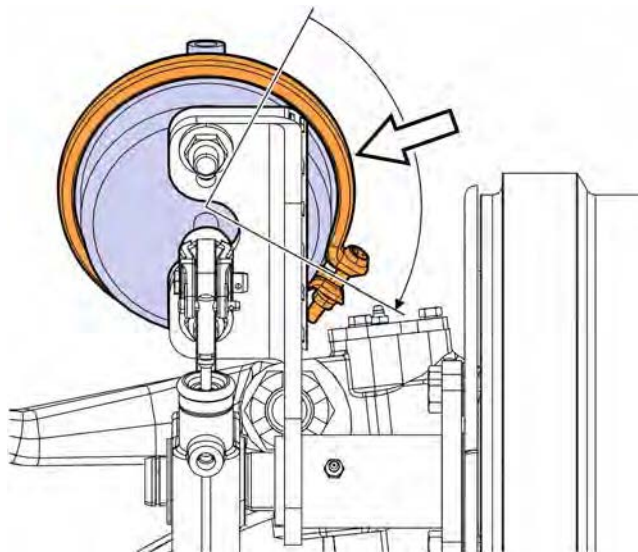

W5092277


17 Install the wheel.

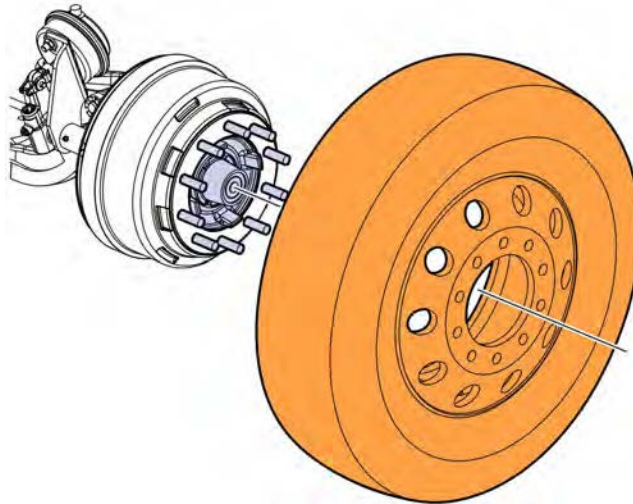

W5092266

18 Install the wheel nuts.


19 Tighten the wheel nuts to 610 Nm (450 ft-lb).

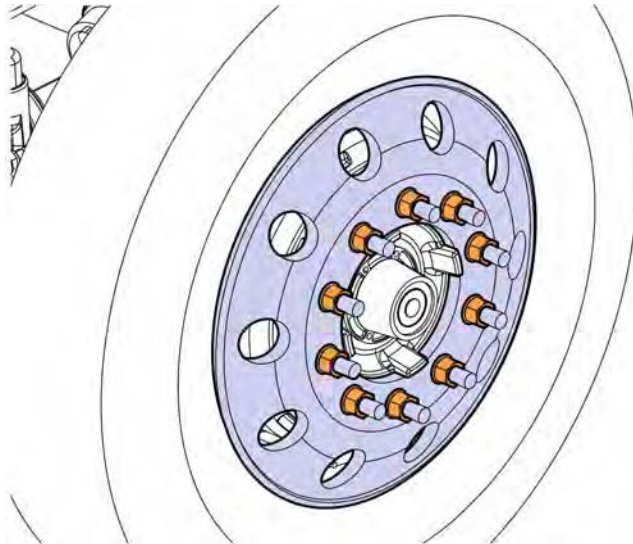

W5092265

20 Adjust the brake as recommended per (slack adjuster) manufacturer.


Note: The Meritor slack adjuster is shown in this procedure for adjusting the brake. However, this procedure is similar for other brands.

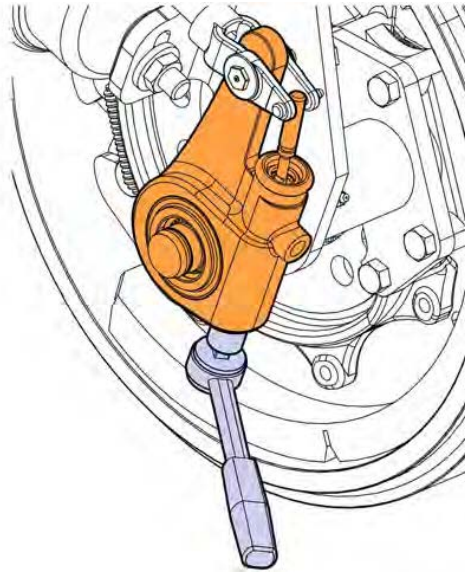

W5092270

21 Install the slack adjuster pawl.

22 Tighten the slack adjuster pawl to 21 ± 3 Nm (186 ± 30 in-lb).

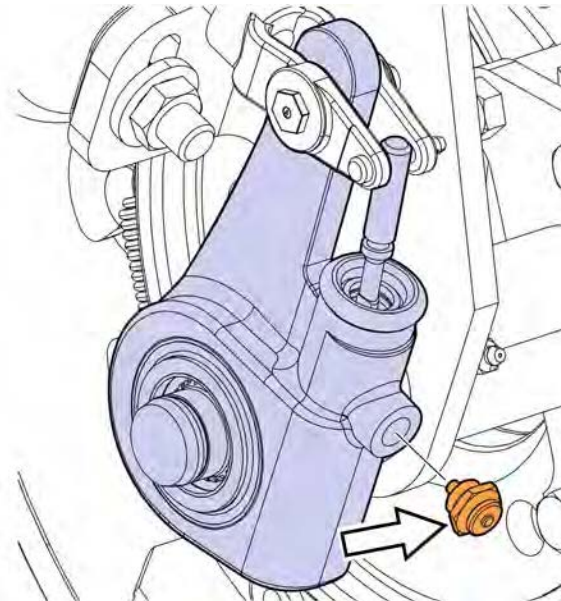


W5092267

- 23 Repeat steps 1 through 22 for the right side of the truck.
24 Lift the steer axle with a jack, remove the jack stands, and lower the axle.
25 Go to Commissioning the Truck for Operation.


Commissioning the Truck for Operation

- 1 Connect the battery cable to the negative (ground) terminal.

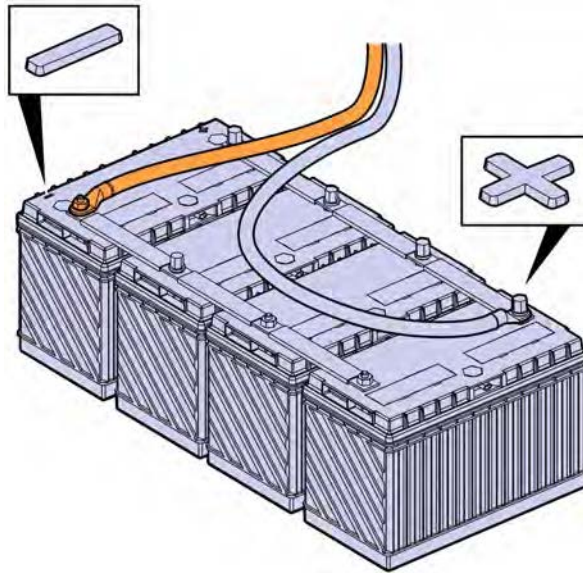

W3086758

- 2 Remove the wheel chocks.

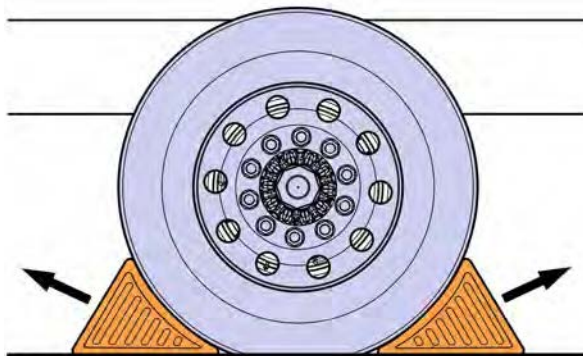

W7086759

Reimbursement

This repair may be eligible for reimbursement if a product failure was experienced within time and mileage limits of the applicable Warranty coverage. Reimbursement is obtained via the normal claim handling process.	UCHP Reimbursement	eWarranty Reimbursement
Claim Type (used only when uploading from the Dealer Bus. Sys.)	W	W
Labor Code		
Primary Labor Code (Brake Drum, Replacement)	5112-03-09-02 1.0 hrs.	51102-0-01 1.0 hrs.
Causal Part	25017906	25017906

VOLVO Trucks North America reserves the right to make any changes in design or to make additions to or upon its products without incurring any obligations to install the same on vehicles previously built.