



Service Bulletin



SB-10056599-9337

Service Update

SUBJECT: Service Update for Inventory and Customer Vehicles
Contact between the Fuel Feed Line and the A/C Pipe
Expires with Base warranty

MODELS: 2013 – 2014 Chevrolet Trax with 1.4L Turbo engine

This service update includes vehicles in dealer inventory and customer vehicles that return to the dealership for any reason. This bulletin will expire at the end of the involved vehicle's New Vehicle Limited Warranty period.

CONDITION

Certain vehicles may have been produced with insufficient clearance between the fuel feed line and the A/C pipe. Should these lines contact one another, the AC line may wear, possibly resulting in a refrigerant leak.

CORRECTION

Dealers are to inspect the A/C pipe for wear and if present, replace the AC line. In addition, dealers are to install a swivel clip to maintain clearance between fuel feed line and A/C pipe

VEHICLES INVOLVED

All involved vehicles are identified by VIN in the Global Warranty Management System - Investigate Vehicle History Application. Dealership technicians should always check this site to confirm vehicle involvement prior to beginning any required inspections and/or repairs. It is important to routinely use this tool to verify eligibility because not all similar vehicles may be involved regardless of description or option content.

Additionally, a list of involved vehicles currently in dealer inventory is attached to the GlobalConnect message used to release this bulletin

PART INFORMATION


Parts required to complete this recall are to be obtained from General Motors Customer Care and Aftersales (GMCC&A). Please refer to your “involved vehicles listing” before ordering parts. Normal orders should be placed on a DRO = Daily Replenishment Order. In an emergency situation, parts should be ordered on a CSO = Customer Special Order.

Part Number	Description	Quantity / vehicle
15034183	Swivel Clip	1
95299470	A/C Evaporator hose assembly	1

SERVICE PROCEDURE

1. Air conditioner pipe inspection


- a. Open the hood of the vehicle.

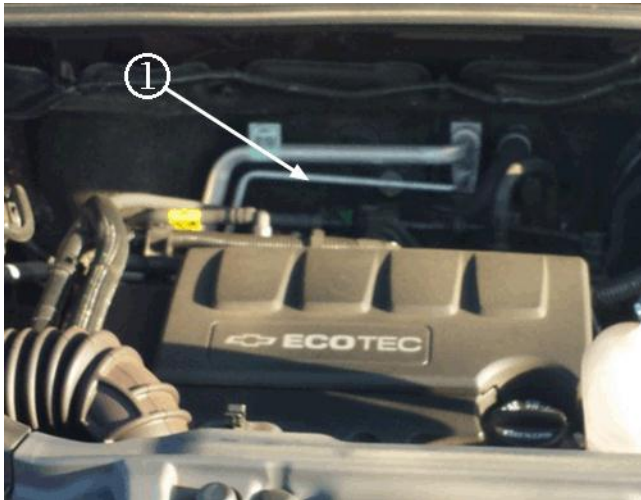

4004602

- b. Locate the A/C pipe (1) for inspection.
- c. Inspect the A/C pipe section (1) that is adjacent to the fuel hose (2):
 - i. If the A/C pipe does not show any sign of wear or damage, proceed to step 2.
 - ii. If the air conditioner pipe is worn or damaged, replace the A/C line, refer to *Air Conditioning Evaporator Hose Assembly Replacement Procedure* in SI.

2. Swivel Clip Installation

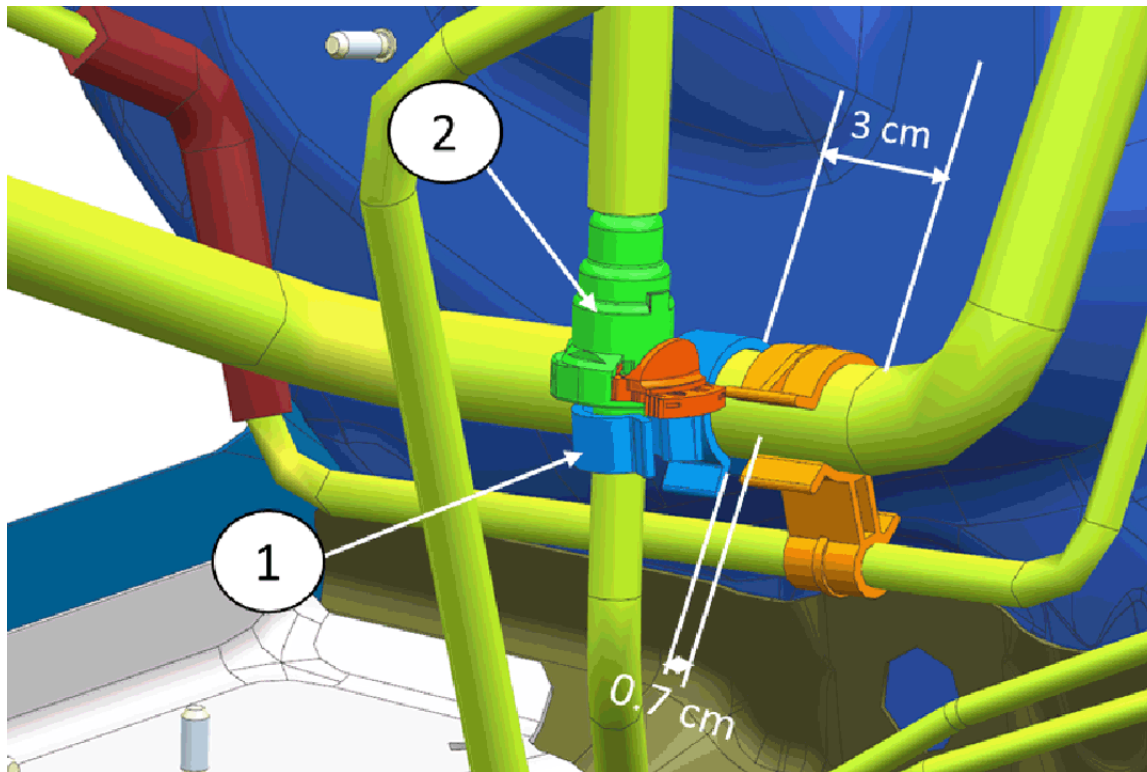

4004608

- a. Install the swivel clip (1) underneath fuel hose quick connector (2) as pictured above.

WARRANTY TRANSACTION INFORMATION

Submit a transaction using the table below. All transactions should be submitted as a ZFAT transaction type, unless noted otherwise.

Labour Code	Description	Labour Time
9101026	A/C pipe inspection and swivel clip installation	0.2
9101027	A/C pipe inspection - replacement and swivel clip installation	0.5

DEALER PROGRAM RESPONSIBILITY

Whenever a vehicle subject to this service update enters your vehicle inventory, or is in your facility for service in the future, and the vehicle is still covered under the New Vehicle Limited Warranty, you must take the steps necessary to be sure the service update correction has been made before selling or releasing the vehicle.

