

**1.6L AND 2.0L ECOBOOST - MALFUNCTION INDICATOR LAMP (MIL)
ILLUMINATED - DTCS P0135, P0132, P0030, P2243 AND/OR P2251**

TSB 14-0129

SB-10056662-6131

FORD:

2013 Escape, Fusion

LINCOLN:

2013 MKZ

ISSUE

Some 2013 Fusion, MKZ, and Escape vehicles equipped with a 1.6L or 2.0L EcoBoost engine and built on 6/1/2012 and through 9/30/2012 may exhibit a MIL illuminated with diagnostic trouble codes (DTCs) P0132, P0135, P0030, P2243 and/or P2251 stored in powertrain control module (PCM) memory.

ACTION

Follow the Service Procedure step to correct the condition.

SERVICE PROCEDURE

Replace the bank 1, sensor 1, heated oxygen sensor (HO2S). Refer to Workshop Manual, Section 303-14.

PART NUMBER	PART NAME
DS7Z-9F472-A	Sensor - HEGO - Escape 1.6L GTDI
BA5Z-9F472-A	Sensor - HEGO -Fusion, MKZ & Escape 2.0L
BA5Z-9F472-B	Sensor - HEGO - Fusion 1.6L GTDI
XL-1	Motorcraft® Penetrating and Lock Lubricant
XL-2	Motorcraft® High Temperature Nickel Anti-Seize Lubricant

OPERATION	DESCRIPTION	TIME
140129A	2013 Escape 1.6L/2.0L EcoBoost: Retrieve DTCs And Replace HO2S (Do Not Use With Any Other Labor Operations)	1.0 Hr.
140129A	2013 Fusion/MKZ 2.0L EcoBoost, 2013 Fusion 1.6L EcoBoost: Retrieve DTCs And Replace HO2S (Do Not Use With Any Other Labor Operations)	0.6 Hr.

WARRANTY STATUS:

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage
Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

DEALER CODING

BASIC PART NO.	CONDITION CODE
9F472	01

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.