

**ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM
FOR AUGUST 2014**

SB-10056751-3343

44670 2013-2014 Fusion/MKZ Not Equipped With A Sony Radio - Chimes Default To Instrument Cluster

Some 2013-2014 Fusion vehicles built on or before 9/11/2013, and MKZ vehicles built on or before 10/22/2013, that are not equipped with a Sony branded radio may exhibit a concern of chimes intermittently emitting from the instrument cluster instead of the audio system after a cold start. Affected chimes may include parking aid, door ajar, and/or parking brake. To correct the concern, reprogram the Audio Control Module (ACM) to the latest level using IDS version 91.03 or higher. Use applicable 12651D labor operations in section 10 of the SLTS manual and use causal part 18C969.