

**NUMBER:** 14-003-14**GROUP:** Fuel System**DATE:** September 09, 2014

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

SUBJECT:

Fuel Spit Back During Refueling (X49 Lifetime Warranty Extension)

OVERVIEW:

This bulletin involves replacing the fuel tank fill tube. This new fill tube incorporates a check valve.

MODELS:

2007 - 2008 (DR) Ram 1500

NOTE: This Extended Warranty Bulletin applies to vehicles equipped with a 3.7L engine (sales code EKG), 4.7L engine (sales code EVA or EVD) or a 5.7L engine (sales code EZB) built on or after February 1, 2007 (MDH 020100) and on or before June 20, 2008 (MDH 062012) at Warren Truck Assembly ("S" in the 11th digit of the VIN) or vehicles built on or after February 1, 2007 (MDH 020108) and on or before June 30, 2008 (MDH 063023) at St. Louis North Assembly ("J" in the 11th digit of the VIN).

SYMPTOM/CONDITION:

Some customers may experience a fuel spit back condition during vehicle refueling.

DIAGNOSIS:

If the customer experiences the symptom/condition, proceed to the repair procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
(1)	68194696AA	Tube, Fuel Fill Vehicles equipped with an 8 ft. bed
(1)	68236559AA	Tube, Fuel Fill Vehicles equipped with a 6.5 ft. bed
(2)	06016076	Strap, tie Requires two per vehicle

REPAIR PROCEDURE:

1. Open Hood.
2. Disconnect and isolate negative battery cable.
3. Remove fuel cap.

4. Hoist vehicle.
5. Cut the tie straps holding the recovery line to the fill tube.
6. Remove the fill tube and discard.
7. Install the new fill tube (68194696AA or 68236559AA) and torque clamps to 3 Nm (30 in. lbs).
8. Tie strap (p/n 06016076) recovery line to the fuel tube in two places.
9. Reconnect the negative battery cable.

POLICY:

Reimbursable within the provisions of the warranty.

NOTE: Vehicles included in this Service Bulletin have lifetime warranty coverage for this repair. See Warranty Bulletins; U.S. D-14-23, Canada SAB-2014-14, International ID-14-11 or Puerto Rico/Virgin Islands ID-14-12 for details associated with the extended warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
14-60-15-97	Tube, Fuel Replace (1 - Semi-Skilled)	8- Engine Performance	0.3 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------