

SB-10057303-2361

Reference	SSM72100
Models	Range Rover / L405 Range Rover Sport / L494
Title	Supporting document for Q442 - Accelerator Pedal
Category	Driveability
Last modified	05-Dec-2014 00:00:00
Symptom	698298 Malfunction Indicator Lamp
Attachments	1Pedal Serial Number Location.pdf LHD - Accelerator Pedal Serial and Part Number List.pdf RHD - Accelerator Pedal Serial and Part Number List.pdf
Content	<u>Issue:</u> A potential concern has been identified with the accelerator pedal on a small number of Range Rover and Range Rover Sport vehicles which may result in the vehicle entering restricted performance mode. <u>Cause:</u> The accelerator pedal switch printed circuit board may not have been correctly soldered leading to an intermittent connection. <u>Action:</u> In conjunction with Q442 please check the serial number of the accelerator pedal in the vehicle to see if it matches a serial number listed in the attached files. If you find a pedal serial number which matches one listed in the attached files then please replace the accelerator pedal. If the accelerator pedal serial number does not match a serial number listed in the attached files then the vehicle can be released. NOTE – there are three files attached, one for LHD (left hand drive) vehicles, one for RHD (right hand drive) vehicles and one file showing a clear picture of where the relevant serial numbers are located on the label attached to the accelerator pedal. Technicians - Please rate this SSM and provide comments so that future communications can be improved. 1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern. 3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern. 5 = Excellent – All required information provided to resolve the customer concern.