

ONLINE AUTOMOTIVE SERVICE INFORMATION
FOR JULY 2014

SB-10057738-6626

44656 2013-2014 Fusion/MKZ - Blind Spot Indicator System (BLIS) With Cross-traffic Alert (CTA) - Fault With Side Object Detection (SOD) DTC U0401 And/Or U0402

Some 2013-2014 Fusion/MKZ vehicles may exhibit an intermittent Blind Spot or Cross Traffic Alert system fault with DTCs U0401 and/or U0402 present in one or both SOD modules. U0401 or U0402 are common DTCs in the SOD modules and should only be addressed if there is a BLIS/CTA customer complaint. If other DTCs exist in the SOD modules, they must be corrected first by referencing WSM 419-04. If DTCs U0401 and U0402 are also found in other modules, refer to WSM section 418-00. If only U0401 or U0402 are present in one or both SOD modules, reprogram both SODs to the latest calibration using IDS version 91.03 and higher. The reprogram will not remedy SOD module DTCs other than a U0401 and/or U0402 and it will not these DTCs in other modules. Use applicable 12651D labor operations in section 10 of the SLTS manual.