

ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM
FOR SEPTEMBER 2014

SB-10057867-1021

44710 2015 F-Super Duty Built On Or Before 06/20/2014 Equipped With Trailer Brake Controller Module - Instrument Panel Cluster Displays 1-Bar Output Without Brake Application.

2015 F-Super Duty vehicles built on or before 06/20/2014 and equipped with TBC brake controller module may exhibit the following customer symptoms, while towing a trailer with the TBC output setting in electric-medium, electric-heavy, and all electric-over-hydraulic (EOH) levels: The IPC message center may display 1-bar output in the trailer screen, while a minimum output signal is sent to the trailer, without driver brake pedal application. This output signal may cause a light trailer brake application on some types of Electronic Over Hydraulic (EOH) trailer brake systems. To correct the condition, replace the TBC module with part # FC3Z-2C006-B. Refer to Workshop Manual (WSM) Section 206-10. For warranty claiming, use casual part 2C006 and applicable 2006D labor operation(s) in Section 02 of the SLTS Manual for the vehicle.