



## TECH TIP: DTCs P0C17 and P1C76 not clearing

NUMBER: TT041

MODEL: Optima Hybrid (TF HEV)

DATE: 02/04/2014

**Symptom:** Replaced HPCU results in two codes that will not clear: P0C17 (Drive motor "A" position sensor not learned) and P1C76 (Generator position sensor not learned).

**Repair:** Perform the motor/HSG resolver calibration located in the S/W management section of the "Motor Control Unit" (MCU) system in GDS.

Note: Tech Tips are not a substitute for proper diagnosis.