

#### **Technical Service Bulletin**

	GROUP	NUMBER				
	CAMPAIGN	14-01-036-1				
5.	DATE	MODEL(S)				
	OCTOBER 2014	ELANTRA SEDAN				
		(UD)				

SUBJECT: OVERHEAD CONSOLE SUNGLASS HOLDER LATCH REPLACEMENT PROCEDURE, (SERVICE CAMPAIGN TT9)

This TSB supersedes bulletin 14-01-036 to add retail vehicles.

#### \* IMPORTANT

#### \*\*\*\*DEALER STOCK AND RETAIL VEHICLES\*\*\*\*\*

Dealers must perform this Campaign on all affected vehicles prior to customer retail delivery and whenever an affected vehicle is in the shop for any maintenance or repair.

When a vehicle arrives at the Service Department, access Hyundai Motor America's "Warranty Vehicle Information" screen via WEBDCS to identify open Campaigns.

**Description:** In some Elantra vehicles the sunglass holder in the overhead console may open unintentionally while driving over bumpy roads. This bulletin describes the procedure to replace the sunglass holder latch to correct this condition.

Additionally, vehicles with a sunroof motor may lose sunroof home position during the replacement part process. This bulletin describes the procedure to reset the sunroof motor (if equipped).

**Applicable Vehicles:** Certain 2014 and 2015 Elantra (UD - American built – VINs starting with 5NPDH\*\*\*) vehicles.

#### Parts Information:

Part Name	Before	After	Qty.
SUNGLASS		92826-3X000QQH	
CASE LATCH		The second secon	

**Warranty Information:** 


Model	Op. Code	Operation	Op. Time
UD Without Sunroof	40CA06R1	SUNGLASS CASE LATCH REPLACEMENT	0.2 M/H
UD With Sunroof	40CA06R2	SUNGLASS CASE LATCH REPLACEMENT AND SUNROOF RESET	0.3 M/H

NOTE: Submit Claim on Campaign Claim Entry Screen


#### Service Procedure:

### SUNGLASS HOLDER LATCH REPLACEMENT


1. Open the sunglass holder (A).

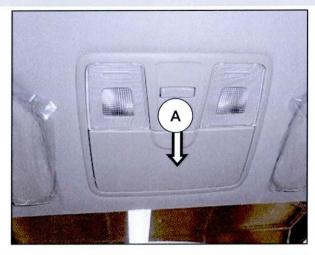

2. Remove the two screws (B).

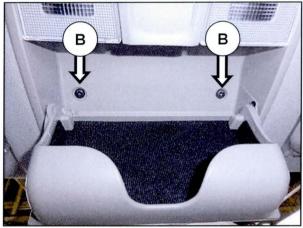

3. Pull down the overhead console (C) to separate it from the headliner.

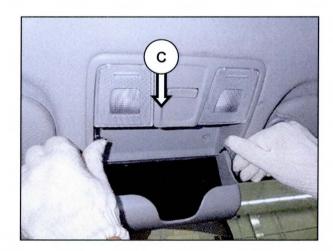


TSB #: 14-01-036-1 Page 2 of 8

4a. Disconnect the connector (D1).

### NOTICE

Picture to the right shows a nonsunroof model.

Remove the overhead console (C) from the vehicle.

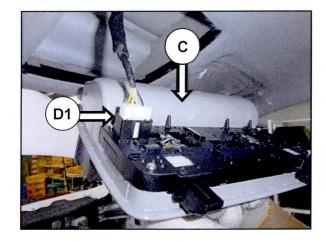

4b. For a sunroof-equipped model, also disconnect the connector (D2).


### NOTICE


A small flathead screwdriver may be required to remove connector (D2).

Remove the overhead console (C) from the vehicle.

## NOTICE

For sunroof-equipped models, a sunroof reset procedure must be performed. After latch replacement is complete, refer to page 6 for sunroof motor reset procedure.

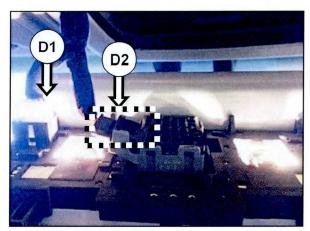

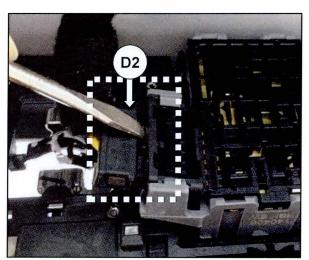


TSB #: 14-01-036-1 Page 3 of 8

5. The sunglass holder latch (E) is located at the front left side of the overhead console.

### **NOTICE**

There is no visible difference between the old and the new part. Be careful to not re-install the old part.




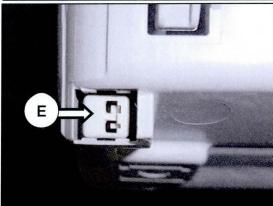

6. Push the back side of the holder latch (E) with a driver (F) to remove the holder latch from the overhead console.

## **A**CAUTION

Set the console on a clean surface that will not get damaged nor cause damage to the console during removal of the holder latch.

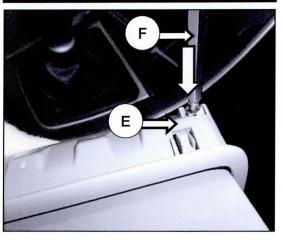


TSB #: 14-01-036-1 Page 4 of 8

#### **SUBJECT:** OVERHEAD CONSOLE SUNGLASS HOLDER LATCH REPLACEMENT (SERVICE CAMPAIGN TT9)

7. Insert the new holder latch (E\*) with needle nose pliers (G) in the orientation shown.

## **A**CAUTION

Before installation, compare the orientation of the holder latch (E\*) with the picture on the right. The slotted side should be facing away from your view.

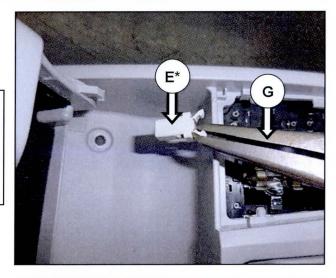


8. Push in the new holder latch (E\*) in the direction of the arrow. You should hear and feel a confirmation "click."



9. Confirm the correct orientation of the holder latch installation by comparing it to the pictures to the right.

Close and open the sunglasses holder to confirm that it operates normally.

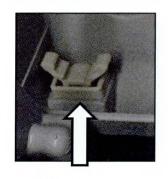

= Correct




10. Reinstall the overhead console by reinstalling the parts in reverse order of removal.

TSB #: 14-01-036-1 Page 5 of 8

### SUNROOF RESET (FOR SUNROOF-EQUIPPED VEHICLES ONLY)

- 1. Start the sunroof reset procedure under the following conditions:
  - Sunshade open
  - Sunroof glass closed

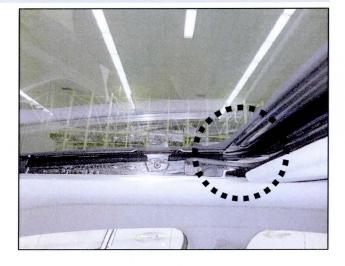


2. Turn the ignition key (A) to the "ON" position. Key start


For push-button start, press button (A) 2 times for "ON" without depressing the brake pedal. (Do not start the engine.)



Push-button start

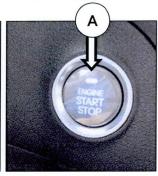


3. Push and hold the sunroof glass switch (B) forward in the direction of close for 10 seconds.

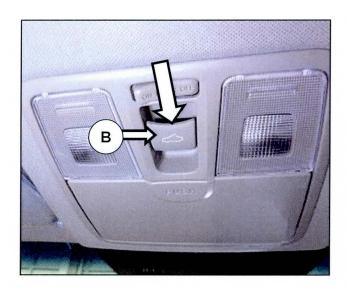

TSB #: 14-01-036-1 Page 6 of 8

#### SUBJECT: OVERHEAD CONSOLE SUNGLASS HOLDER LATCH REPLACEMENT (SERVICE CAMPAIGN TT9)


4. Keep holding the switch until the sunroof glass automatically tilts up and then moves up/down slightly.

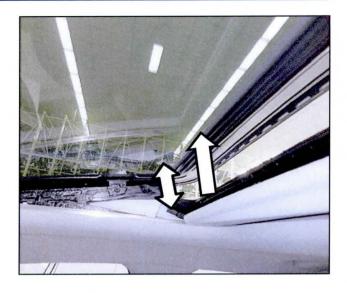


- 5. After the sunroof glass moves in Step 4, release the sunroof switch (B).
- 6. Within 3 seconds of releasing the switch (B), push and hold the switch (B) forward in the direction of close again until the sunroof glass moves as follows:
  - Tilt down → Slide open → Slide close

# **A** CAUTION

DO NOT release the control lever (B) until the operation is completed. If you release the control lever (B) during the operation, you must restart the sunroof resetting procedure.

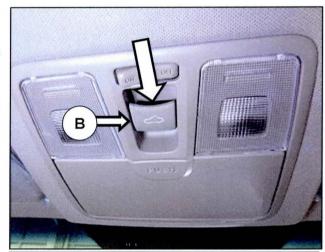

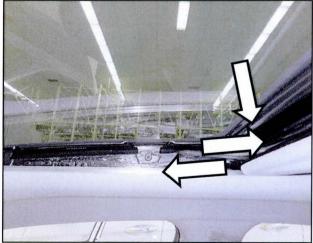


TSB #: 14-01-036-1 Page 7 of 8


#### SUBJECT: OVERHEAD CONSOLE SUNGLASS HOLDER LATCH REPLACEMENT (SERVICE CAMPAIGN TT9)

- 7. Confirmation:
  - a. Push the sunroof glass switch (B) rearward past the detent to open the glass completely.
  - b. Push the sunroof glass switch (B) forward past the detent to close the glass completely.



If the sunroof glass does not open or close fully when pressing the switch one time past the detent, repeat the sunroof motor reset procedure.

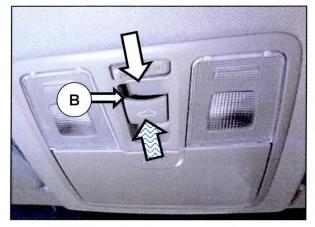

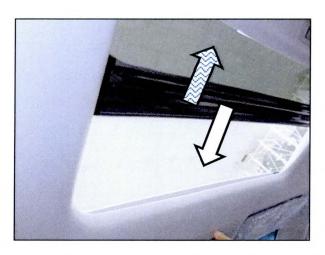

TSB #: 14-01-036-1 Page 8 of 8