



HYUNDAI

NEW THINKING.
NEW POSSIBILITIES.

Technical Service Bulletin

GROUP	NUMBER
CAMPAIGN	14-01-042
DATE	MODEL(S)
OCTOBER 2014	EQUUS (VI)

SUBJECT: LEFT AND RIGHT REAR DOOR CURTAIN ECU REPLACEMENT
(SERVICE CAMPAIGN TU4)

*** IMPORTANT**

***** Dealer Stock and Retail Vehicles *****

Dealers must perform this Service Campaign on all affected vehicles prior to customer retail delivery and whenever an affected vehicle is in the shop for any maintenance or repair.

When a vehicle arrives at the Service Department, access Hyundai Motor America's "Warranty Vehicle Information" screen via WEBDCS to identify open Campaigns.

Description: This bulletin provides a service procedure to replace the rear door curtain ECU. Certain vehicles may exhibit a condition where the rear door curtains will not roll up or down.

Applicable Vehicles: 2015 EQUUS Equipped with Rear Door Curtains




Rear Driver and Passenger
Door Curtain ECU

Circulate To: General Manager, Service Manager, Parts Manager, Warranty Manager, Service Advisors, Technicians, Body Shop Manager, Fleet Repair

SUBJECT: LEFT AND RIGHT REAR DOOR CURTAIN ECU REPLACEMENT

Parts Information:

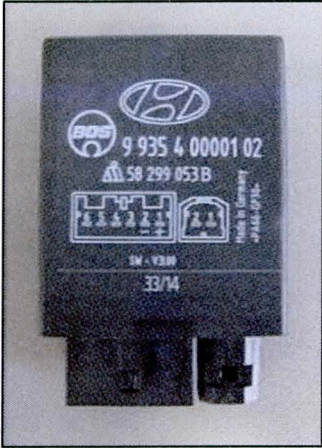PART NAME	PART NUMBER
Rear Door Curtain ECU	 <p>The image shows a black rectangular electronic control unit (ECU) for a rear door curtain. It features the Hyundai logo at the top, followed by the part number '9 935 4 00001 02' and '58 299 053 B'. There are also some smaller markings and a date '33/14' at the bottom.</p>
	83353-3N000QQH (Qty. 2)
	S/W Ver. 3.0 (Rear Driver and Passenger Side)

Warranty Information:

OP CODE	OPERATION	OP TIME
40C050R1	LEFT AND RIGHT REAR DOOR CURTAIN ECU REPLACEMENT	1.0 M/H

NOTE: Submit Claim on Campaign Claim Entry Screen


SUBJECT: LEFT AND RIGHT REAR DOOR CURTAIN ECU REPLACEMENT

Service Procedure:


1. Remove the rear driver side door frame inner cover (A).

NOTICE


Carefully pull the top left and top right corner to remove the side door frame cover.

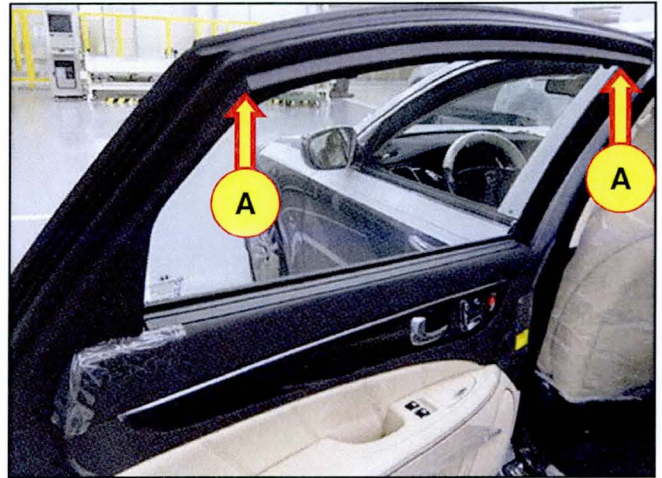

2. Remove the rear door inside handle cover (B), and then remove the screw.

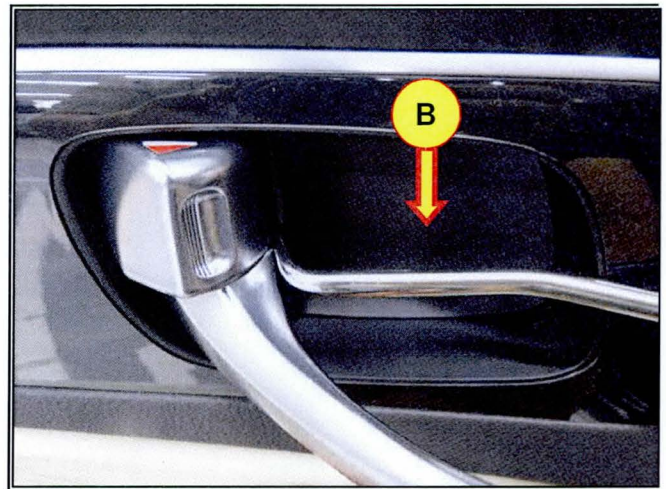

3. Remove the rear door pull-handle cap (C), and then remove the screw.

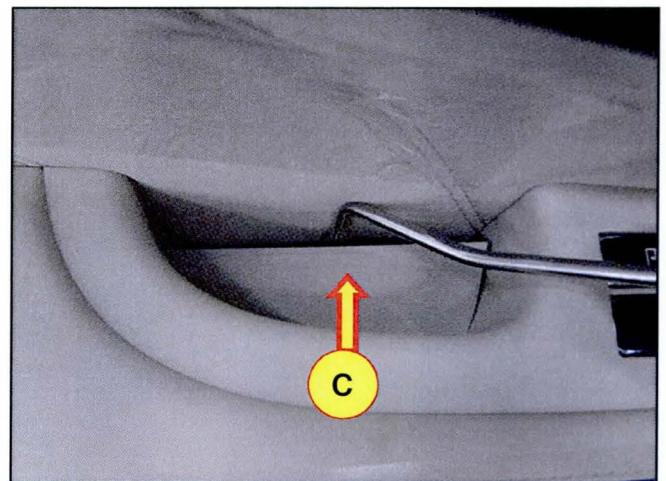

SUBJECT: LEFT AND RIGHT REAR DOOR CURTAIN ECU REPLACEMENT


4. Separate the rear door trim from the door by pulling the lower part of the trim.




- 5.

NOTICE

When separating the trim (D), pull the upper part and lower part simultaneously. Otherwise, the trim may be broken.

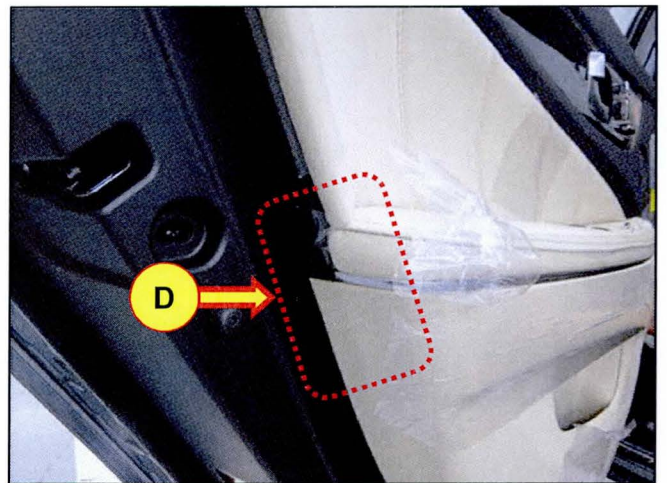


6. Separate the door inside handle cage (F) by pushing the hook (E).

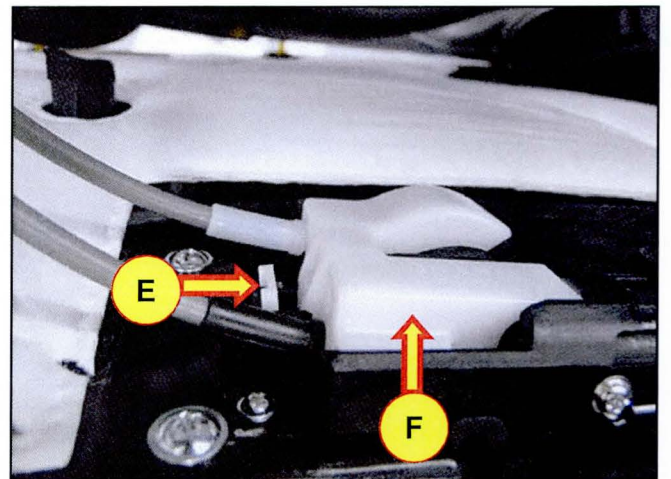


SUBJECT: LEFT AND RIGHT REAR DOOR CURTAIN ECU REPLACEMENT

7. Disconnect the power connector (G), and then remove the rear door trim.

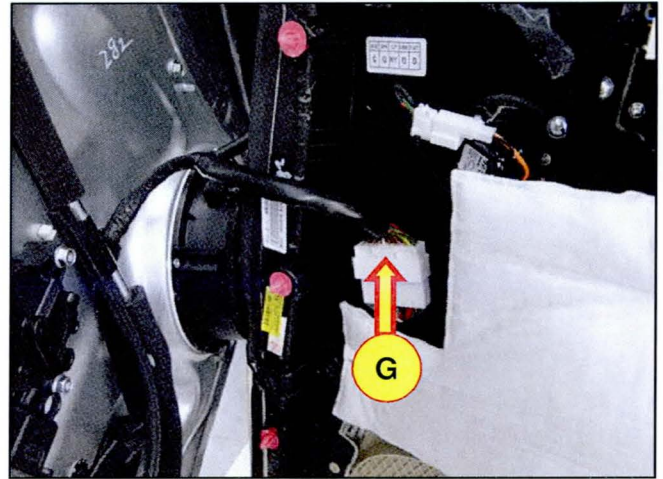


8. Using a needle nose plier remove the connector (H) from the metal bracket.

Remove the rear door curtain ECU (I) by sliding it upward as shown in the directional arrow.

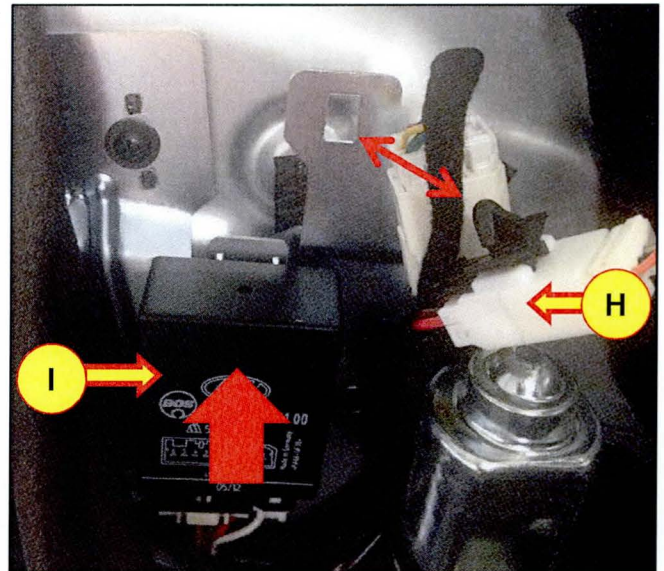

9. Disconnect the connector (J1) by pressing the hook.

Disconnect the connector (J2) by pressing the locking tab.

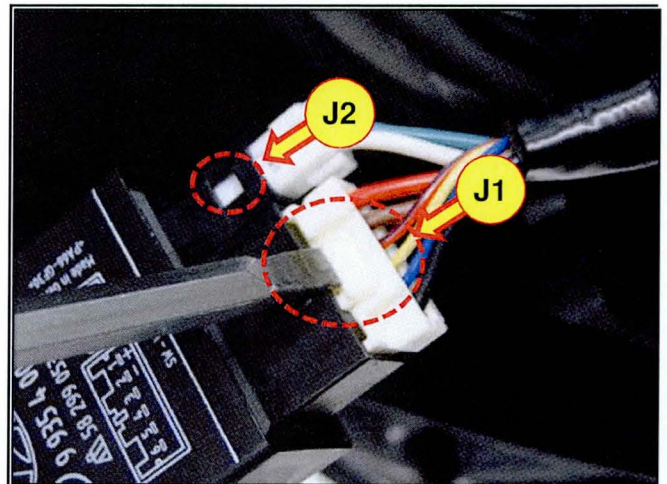

SUBJECT: LEFT AND RIGHT REAR DOOR CURTAIN ECU REPLACEMENT

10. Install the new ECU (K) in reverse of removal.

NOTICE

Confirm the part number and S/W version of the new ECU.


	PART ID	S/W VER.
PREVIOUS	9 935 4 00001 <u>01</u> (Rear Driver and Passenger Side)	V <u>2.00</u>
NEW	9 935 4 00001 <u>02</u> (Rear Driver and Passenger Side)	V <u>3.00</u>



Rear Driver/Passenger Side

11. Initiate the rear driver side door curtain ECU as follows:

- 1) Lift the switch (L) to partially expand it.
- 2) Press the switch (L) to completely fold it.
- 3) Lift the switch (L) to fully expand it.

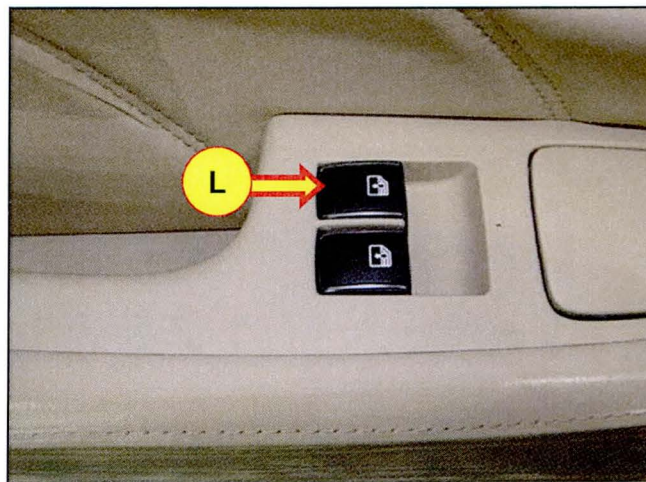

12. Repeat same procedure above for the rear passenger side door.