



HYUNDAI

NEW THINKING.
NEW POSSIBILITIES.

Technical Service Bulletin

GROUP

CAMPAIGN

NUMBER

14-01-055

DATE

DECEMBER 2014

MODEL

ELANTRA (MD)

SUBJECT: SUNROOF DEFLECTOR REPLACEMENT
(SERVICE CAMPAIGN TV6)

Description: On some 2015 ELANTRA (MD) vehicles, a rattle noise from the sunroof deflector may be heard while driving. This bulletin provides the procedure to replace the deflector with a revised deflector spring.

★ IMPORTANT

*******DEALER STOCK ONLY*******


Dealers must perform this Service Campaign on all affected vehicles prior to customer retail delivery.

When a vehicle arrives at the Service Department, access Hyundai Motor America's "Warranty Vehicle Information" screen via WEBDCS to identify open Campaigns.



■ **Applicable vehicles:** Certain 2015 Elantra built in Korea equipped with sunroof.

SUBJECT:**SUNROOF DEFLECTOR REPLACEMENT
(SERVICE CAMPAIGN TV6)****Parts Information:**

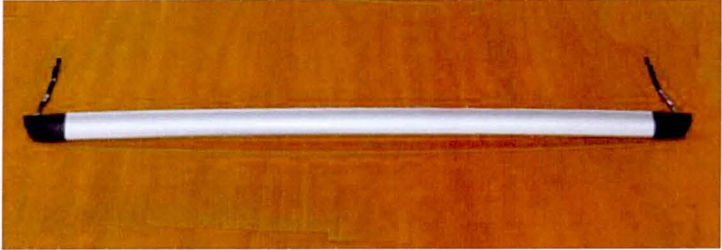Part Name	Part Number
Sunroof Deflector Assembly	 A photograph of a long, white, cylindrical sunroof deflector assembly with black end caps and small metal tabs at each end, resting on a wooden surface.
Sunroof Deflector Assembly	81641-3X000QQH

Warranty Information:

Op Code	Operation	Op Time
40C058R4	Sunroof Deflector Spring Replacement	0.3


NOTE: Submit claim on Campaign Claim Entry Screen

SUBJECT:


**SUNROOF DEFLECTOR REPLACEMENT
(SERVICE CAMPAIGN TV6)**

SERVICE PROCEDURE:

1. Turn 'ON' the ignition switch and open the sunroof by pressing the switch (A).
Turn 'OFF' the ignition switch.

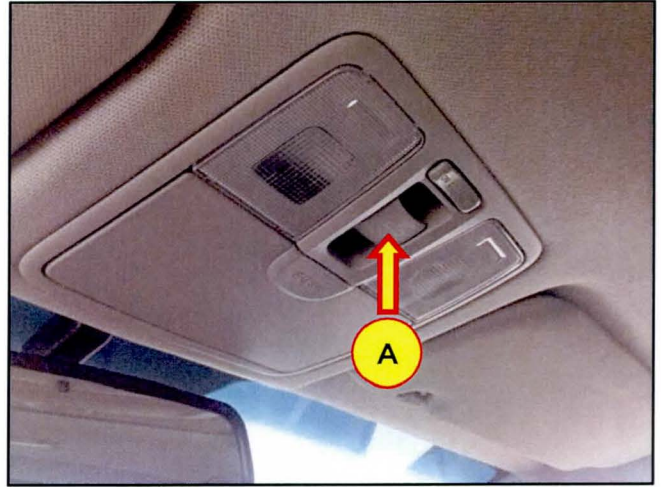

2. Remove the deflector mounting screw (B) on both sides.

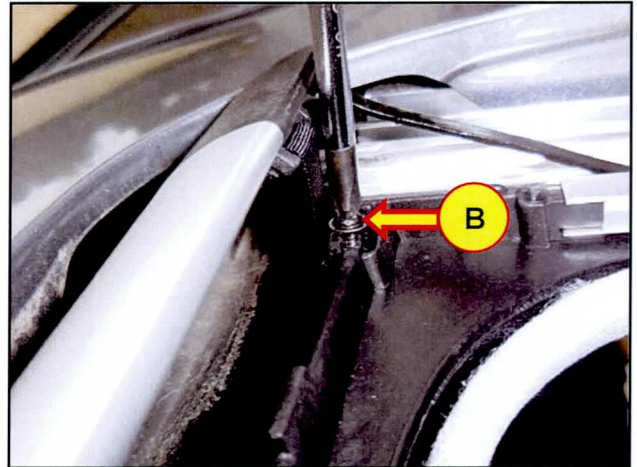

3. Remove the sunroof deflector (C) from the vehicle and then install the newly improved one in reverse order of removal.

Test the sunroof to ensure normal operation.

