

Navigation System Firmware Update

Service
Category Audio/Visual/Telematics

Section Navigation/Multi Info Display

Market USA

Lexus Supports
ASE Certification 

Applicability

| YEAR(S) | MODEL(S) | ADDITIONAL INFORMATION |
|---------|----------|------------------------|
| 2014 | CT200H | |

Introduction

Some 2014 model year CT 200h vehicles equipped with navigation (version less than V10C8710) may exhibit one or more of the following conditions:

- Black screen after ACC ON
- Disconnecting and reconnecting Bluetooth® device
- Manually disabling Bluetooth® from the handset results in inability of head unit to reconnect to handset

A software update is now available to address these conditions.

Warranty Information

| OP CODE | DESCRIPTION | TIME | OFP | T1 | T2 |
|---------|-----------------|------|-------------|----|----|
| EL1313 | Update Software | 0.3 | 86804-76080 | 87 | 74 |

APPLICABLE WARRANTY

- This repair is covered under the Lexus Basic Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Navigation System Firmware Update

Required Tools & Equipment

| SPECIAL SERVICE TOOLS (SST) | PART NUMBER | QTY | APPLICABLE FILE ON THE USB DRIVE** |
|--|---------------------------------|-----|------------------------------------|
| USB Drive Navigation Map Update – Denso* | 02023-DENSO-14B | 1 | 13LHENNA-AB01_1004.kwi |

* Essential SST.

** For Information Only.

NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

Repair Procedure


1. Confirm the software version.
 - A. Start the engine. The *LEXUS* emblem will be displayed on the navigation screen.

Figure 1.



- B. Wait for the display to switch to the *Caution* screen, and then select *Continue*. The map screen will display.

Figure 2.

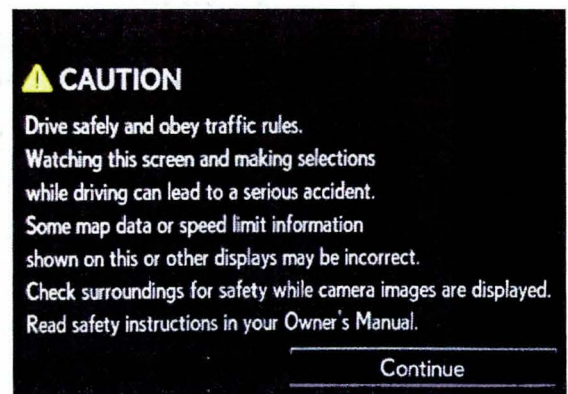

- C. Connect USB Drive SST to the USB port.

Navigation System Firmware Update

Repair Procedure (Continued)

D. From the navigation menu, select *Setup*.

Figure 3.




E. Select *General*.

Figure 4.



F. Select *Software Update*.

Figure 5.

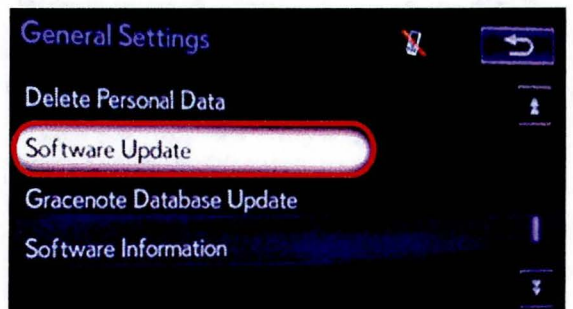

Navigation System Firmware Update

Repair Procedure (Continued)

G. Select *Update*.

Figure 6.




H. Confirm the current version is older than the new version.

- If the current version is V10C8710 or greater, **STOP** – this bulletin does NOT apply.
- If the current version is less than V10C8710, proceed to the next step.

2. Update software version.


A. Select *Update Software*.

Figure 7.

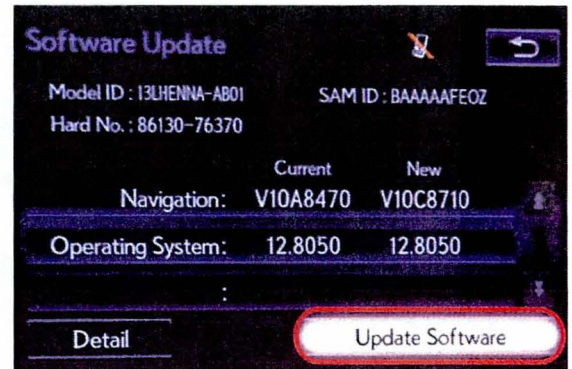

B. Select *Yes*.

Figure 8.

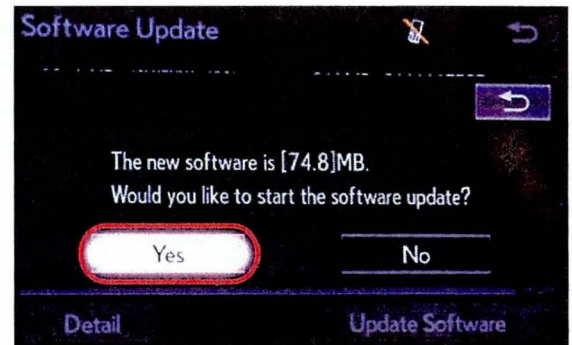


Navigation System Firmware Update

Repair Procedure (Continued)


C. Wait for the software to install.

Figure 9.

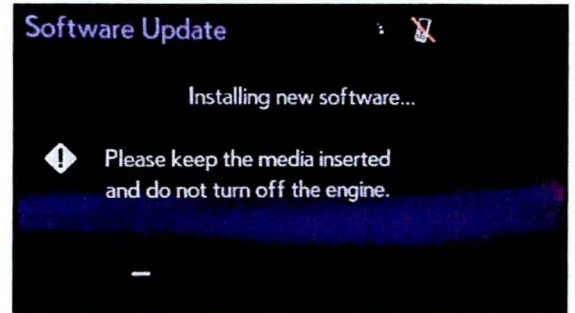

D. Cycle the ignition OFF and ON to complete the update.

Figure 10.

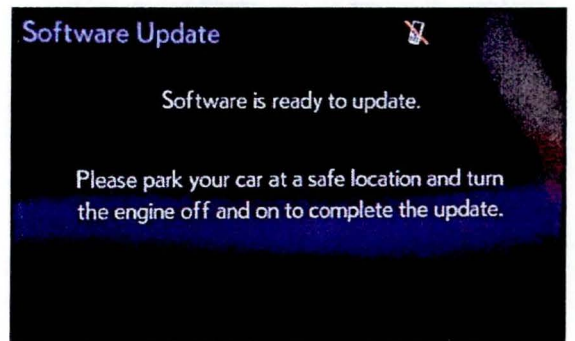

E. Remove the USB Drive SST.

F. Confirm the current software version has been updated on the *software Update* screen.

Figure 11.

