	TO	ΛΤΟ	Tecl
ubject	State Prove St	[1] [1] [1] [2] [2] [2] [2] [2] [2] [2] [2] [2] [2	· · · · · · · · · · · · · · · · · · ·

ech Tip T-TT-0287-14

Market

USA

2014 Tundra Vehicles With Steel Bumper Ultrasonic Parking Sensor Installation

Audio/Visual/Telematics

2014 Tundra

APPLICABLE VEHICLES

2014

Tundra

Section


Park Assist/Monitoring

CONDITION

Park Assist False Activation on Vehicle with Steel Bumpers

RECOMMENDATIONS

- Do not reuse the ultrasonic sensor retainer on vehicles that have a false activation concern
- When reinstalling an ultrasonic sensor into the steel bumper, pay special attention to step 2 sub section (a) in the repair manual document for sensor installation.
- 2. INSTALL NO. 2 ULTRASONIC SENSOR RETAINER (for Steel Type Bumper)

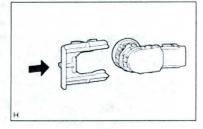

(a) Install the No. 2 ultrasonic sensor retainer as shown in the illustration.


• For proper sonar sensor operation the sensor retainer must be installed straight and fully seated onto the sensor (please see examples on following page)

Expires on 09/19/2014

Ver. 2.3 01/01/2014 T

© 2014, Toyota Motor Sales, USA

Page 1 of 3

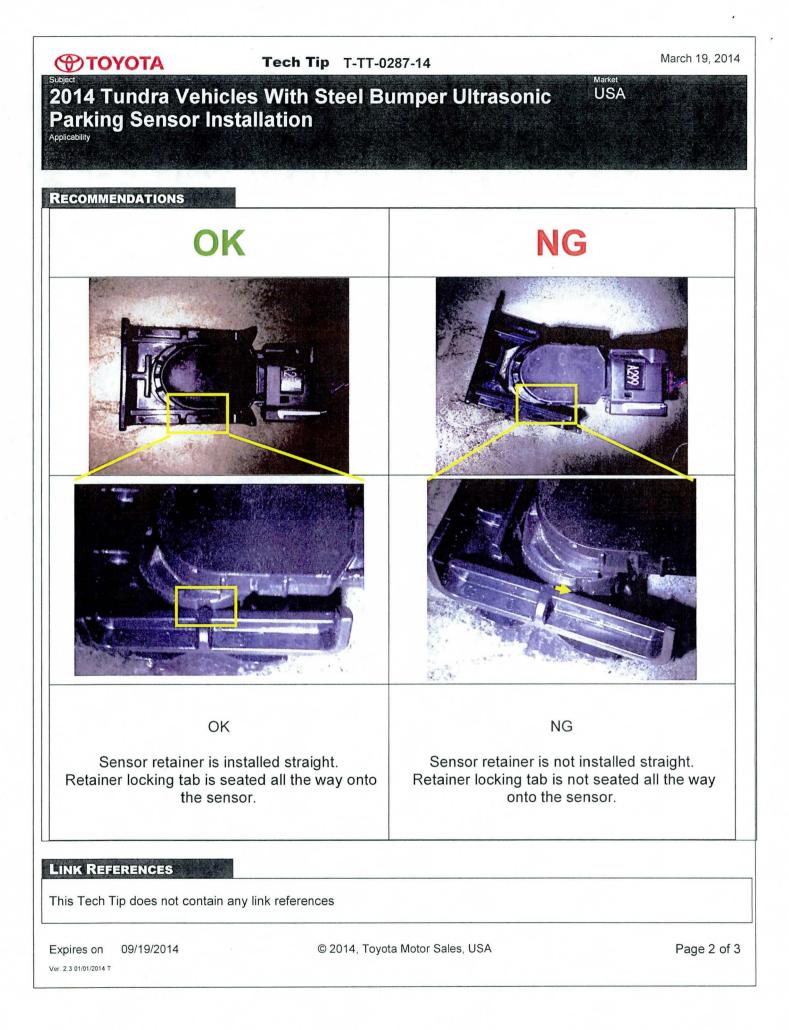

ATOYOT

Tech Tip T-TT-0287-14

Subject 2014 Tundra Vehicles With Steel Bumper Ultrasonic USA

Parking Sensor Installation

Click here to enter text.

Expires on 09/19/2014 Ver: 2.3 01/01/2014 T © 2014, Toyota Motor Sales, USA

March 19, 2014