



**NUMBER:** 08-058-14

**GROUP:** Electrical

**DATE:** July 19, 2014

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.

**THIS BULLETIN SUPERSEDES SERVICE BULLETIN 08-003-13 REV. A , DATED MAY 03, 2013, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **\*\*ASTERISKS\*\*** AND INCLUDES A RESTRICTION ON THE POPULATION INVOLVED.**

**SUBJECT:**

Clock In The Radio Loses Time

**OVERVIEW:**

This bulletin involves replacing the Wireless Control Module (WCM)/Sentry Key Remote Entry Module (SKREEM).

**MODELS:**

2009 - 2012	(JK)	Wrangler
2009 - 2012	(KK)	Liberty
2009 - 2011	(KA)	Nitro

**NOTE: \*\* This bulletin applies to all the vehicles NOT equipped with 2.8L 4 CYL TURBO DIESEL ENGINE (sales code ENS). \*\***

**SYMPTOM/CONDITION:**

Customer may experience a condition where the clock will lose over one minute a month.

**DIAGNOSIS:**

If the customer describes the symptom, perform the Repair Procedure.

**PARTS REQUIRED:**

Qty.	Part No.	Description
1 (AR)	68209969AA	SCREEM/WCM, With remote start (sales code XBM)
1 (AR)	68209837AA	SCREEM/WCM
1 (AR)	68209838AA	SCREEM/WCM, (International only)
1 (AR)	68209970AA	SCREEM/WCM, With Thatcham.(LS9 sales code)
**1 (AR)	68223406AA	SCREEM/WCM, sales code (XGM)**

**REPAIR PROCEDURE**

1. Replace the WCM/SCREEM, follow the remove and installation procedure per TechConnect: Vehicle Theft Security/MODULE, Sentry Key Immobilizer (SKREEM)/Removal/installation.
2. Make sure to read and follow all notes regarding key Transponders and Tire pressure sensor reprogramming.
3. Clear all codes that may have been set during the replacement procedure.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

<b>Labor Operation No:</b>	<b>Description</b>	<b>Amount</b>
08-80-28-91	Module, Screem, Replace (KK/KA) (2-Skilled)	0.5 Hrs.
08-80-28-91	Module, Screem, Replace (JK) (2-Skilled)	0.6 Hrs.

**FAILURE CODE:**

ZZ	Service Action
----	----------------