



NUMBER: 09-002-14 REV. B

GROUP: Engine

DATE: December 15, 2014

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

THIS BULLETIN SUPERSEDES SERVICE BULLETIN 09-002-14 REV. A, DATED OCTOBER 3, 2014, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS****.**

SUBJECT:

MIL Illumination: P0300, P0302, P0304 or P0306 (X56 Warranty Extension)

OVERVIEW:

This bulletin involves checking for excessive cylinder leakage and replacing the cylinder head if necessary.

MODELS:

2011 - 2013	(JC)	Journey
2012 - 2013	(JK)	Wrangler
2011 - 2013	(JS)	200/Avenger
2011 - 2013	(LC)	Challenger
2011 - 2013	(LD)	Charger
2011 - 2013	(LX)	300
2011 - 2013	(RT)	Grand Caravan/Town & Country
2011 - 2013	(WD)	Durango
2011 - 2013	(WK)	Grand Cherokee

NOTE: This Extended Warranty Bulletin applies to vehicles equipped with a 3.6L engine (sales code ERB).

SYMPTOM/CONDITION:

Customers may experience a Malfunction Indicator Lamp (MIL) illumination. Upon further investigation the Technician may find that any the following Diagnostic Trouble Codes have been set:

- P0300- Multiple Cylinder Misfire
- P0302- Cylinder 2 Misfire
- P0304- Cylinder 4 Misfire
- P0306- Cylinder 6 Misfire

DIAGNOSIS:

If the customer experiences the symptom/condition, proceed to the repair procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
(1)	RL141353AC	Cylinder Head
(1)	05184455AI	Gasket, Cylinder Head
(6)	05184562AC	Seal, Intake Plenum
(6)	05184331AC	Seal, Intake Manifold
** (1)	5184595AE	Gasket, Cylinder Head Cover, Right (As Required)**
** (1)	5184596AE	Gasket, Cylinder Head Cover, Left (As Required)**
** (1)	68078604AA	Gasket Kit, Chain Case Cover**
(1)	68082860AA	RTV, Threebond Engine
(1)	68079744AC	Filter, Engine Oil
(AR)	04761838AD	Oil, Engine

REPAIR PROCEDURE:

1. Perform a cylinder leakage test on cylinders 2, 4 and 6. Follow the detailed service procedures available in DealerCONNECT/TechCONNECT, Refer To Group 9 - Engine, 3.6L> Diagnosis and Testing> Cylinder Leakage Test.
2. Do any of the cylinders exhibit leakage of 25% or greater?
 - a. If Yes>>> Proceed to Step 3.
 - b. If No>>> This bulletin does not apply. Proceed with normal diagnostic procedures.

NOTE: Record all cylinder leakage test results on the Repair Order.

3. Replace the left cylinder head. Follow the detailed service procedures available in DealerCONNECT/TechCONNECT, Refer To Group 9 - Engine, 3.6L> Cylinder Head> Removal/Installation.

POLICY:

Reimbursable within the provisions of the warranty.

NOTE: Vehicles included in this Service Bulletin have extended warranty coverage for this repair. See Warranty Bulletins; U.S. D-14-12, Canada SAB-2014-11, International ID-14-03, Puerto Rico/Virgin Islands ID-14-04 or Mexico BG-22-14 for details associated with the extended warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
09-35-09-90	Cylinder Leakage Test Only (3 - Highly Skilled)	1 - Engine Repair	1.0 Hrs.
09-35-03-93	Head, Cylinder Assembly - Replace Left/Front Side (Includes cylinder leakage test) (3 - Highly Skilled) LC/LD/LX	1 - Engine Repair	8.2 Hrs.
09-35-03-93	Head, Cylinder Assembly - Replace Left/Front Side (Includes cylinder leakage test) (3 - Highly Skilled) WD/WK	1 - Engine Repair	8.7 Hrs.
09-35-03-93	Head, Cylinder Assembly - Replace Left/Front Side (Includes cylinder leakage test) (3 - Highly Skilled) JK	1 - Engine Repair	9.0 Hrs.
09-35-03-93	Head, Cylinder Assembly - Replace Left/Front Side (Includes cylinder leakage test) (3 - Highly Skilled) JS/RT	1 - Engine Repair	9.8 Hrs.
09-35-03-93	Head, Cylinder Assembly - Replace Left/Front Side (Includes cylinder leakage test) (3 - Highly Skilled) JC	1 - Engine Repair	10.2 Hrs.
Opt. Operation No:	Description		Amount
09-35-03-94	AWD Equipped LD/LX	1 - Engine Repair	0.8 Hrs.
09-35-03-94	4X4/AWD Equipped WD/WK	1 - Engine Repair	1.6 Hrs.
09-35-03-95	Rear A/C Equipped JC	1 - Engine Repair	0.2 Hrs.
09-35-03-96	Air Suspension Equipped WK	1 - Engine Repair	0.3 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------