



Notification of Safety Recall P046: Supplementary Restraint System Warning Lamp Illuminated

SERVICE
BULLETIN

07-JUL-14 | No.: SRE14-05 | Section: RECALL | Market: USA

Jaguar Land Rover North America, LLC has informed the National Highway Traffic Safety Administration (NHTSA) of its intent to perform a voluntary Safety Recall involving certain 2010-2015 model year Land Rover LR2 and 2012-2013 model year Range Rover Evoque vehicles imported into the United States market. Information relating to the Recall will be posted on the National Highway Traffic Safety Administration website.

United States Federal regulations require that retailers must be advised of this Recall notification within three working days after government notification.

United States Federal law requires retailers to complete any outstanding safety Recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a retailer could result in a civil penalty of up to \$7,000.00 per vehicle.

This Recall Service Bulletin serves as notification to all Land Rover retailers in the United States that any affected new vehicles may not be sold and delivered for customer use until the Recall repair is completed.

AFFECTED VEHICLES

Approximately 17,095 2010-2015 model year Land Rover LR2 (L359) and 23,539 2012-2013 model year Range Rover Evoque (L538) vehicles in the USA are affected.

The VIN ranges of the affected vehicles are:

- LR2 (L359) SALFT2BN1AH144657-SALFA2DC0FH425096
- Range Rover Evoque (L538) ... SALVT1BG2CH000447-SALVR2BG6DH856579

DESCRIPTION OF DEFECT

A concern has been identified with the Supplementary Restraint System (SRS) passenger airbag which may be totally or partially disabled as a result of physical cell wear out of the Electrically Erasable Programmable Read-Only Memory (EEPROM) within the Occupant Classification System (OCS) Electronic Control Unit (ECU). When this condition is detected by the SRS system self-test, completed at ignition on, the OCS ECU will shut down.

This condition results in Diagnostic Trouble Code (DTC) U0154:00 being set in the Restraints Control Module (RCM) along with continuous illumination of the SRS warning lamp on the instrument cluster. Range Rover Evoque vehicles will also illuminate the Passenger Airbag Disable indicator (PADi) lamp in the overhead console. The condition may clear on the next subsequent ignition cycle.

EFFECT ON VEHICLE OPERATION

During the SRS system self-test if this condition illuminates the SRS warning lamp for LR2 vehicles, the system defaults to stage 1 deployment of the passenger airbag only. In the case of Range Rover Evoque, the passenger airbag defaults to off and will not deploy. In the event of a crash, the SRS system will not operate to design intent, therefore increasing the risk of injury to the vehicle occupants.

Jaguar Land Rover is not aware of any reports of accidents or injuries attributed to this condition.

SERVICE PROGRAM / REWORK ACTION

Vehicle owners will be notified and instructed to take their vehicle to an authorized Land Rover retailer who will update the Restraints Control Module (RCM) with the latest software.

There will be no charge to owners for this repair.

OWNER NOTIFICATION

Mailing of owner notification letters will occur on or before 30 August 2014.

ACTION TO BE TAKEN

Retailers are required to check DDW to ensure a vehicle is affected by Program Code 'P046' and **HOLD** all affected new vehicles in your control and withhold them from onward distribution pending completion of the rework action. Sold vehicles will be subject to the standard Recall notification and Recall bulletin process detailing the action required for vehicles in the hands of owners.

Retailers are advised that the use of vehicles within the affected model year / VIN range as Sales Demonstrator or Service Loaner vehicles may be considered a violation of Federal legislation. Jaguar Land Rover North America, LLC recommends against using affected vehicles for demonstrator or loaner purposes. Please consult your own legal counsel if you have questions in this regard.

Thank you for your cooperation in this matter. Jaguar Land Rover North America apologizes for any inconvenience this may cause.