

Reference	SSM70758
Models	Range Rover (All New) / L405
Title	Keyless Vehicle Module updates and key replacement 13MY Only
Category	Electrical
Last modified	06-Jan-2014 00:00:00
Symptom	205000 Electrical Accessories
Content	<p>Issue: After programming (13MY only) Keyless Vehicle Module (KVM) using SDD DVD136 Patch 2, it will be noticed that the Passive Entry System operates only when the key is held close to the door handle, typically within a range of 10 centimetres. This is a default mode as a result of the software download.</p> <p>In addition the smart key range within the vehicle may also be reduced and the 'Smart Key Not Found' message may appear on the Instrument Cluster. If this is the case, it will be necessary to follow the keyless start back up strategy with reference to the owner's handbook</p> <p>Cause: Software compatibility issue now resolved with the release of DVD136; Patch file 4; Cal 160</p> <p>Action: If the concern above is reported, re-configure the KVM software using DVD136; Patch file 4; Cal 160 or later.</p> <p>Note: This SSM supersedes 70538 with immediate effect. All key programming and KVM software update activities may continue as normal (all model years) where necessary, using DVD136; Patch 4; Cal 160 or later.</p>